



# ***Precision Rated Optics***

***Work with a PRO!***

## **TP-P6 Manual**

***Multifunctional Test Platform***



## **Notice**

Copyright, Precision Rated Optics®, All rights reserved.

No part of this manual may be reproduced in any form or by any means (including electronic storage and retrieval or translation into a foreign language) without prior agreement and written consent from Precision Rated Optics®, as governed by international copyright laws.

## **Warranty**

The material contained in this document is subject to change without notice. Precision Rated Optics® makes no warranty of any kind with regard to this material, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose. Precision Rated Optics® shall not be liable for errors contained herein or for incidental or consequential damages in connection with furnishing, performance, or use of this material.

The battery is a consumable part and is not subject to the PRO TP-P6 warranty.

## **ISO 9001 Certification**

Produced to ISO9001 International Quality System Standard as part of Precision Rated Optics®, objective of continually increasing customer satisfaction through improved process control.

Precision Rated Optics® objective, which continually increasing customer satisfaction through improved process control.

## **Safety Instructions**

During each stage of operation of this instrument, please always observe the following safety instructions. Not taking proper safety precautions, or not following the instructions, will violate the safety standards of the design, manufacturing and application of these instruments. In no case will Precision Rated Optics bear the responsibilities for consequences incurred by violation of the following instructions.

Information contained in this manual is believed to be accurate and reliable. However, no responsibility is assumed by Precision Rate Optics for its use nor for any infringements of patents or other rights of third parties that may result from its use. No license is granted by implication or otherwise under any patent rights of Precision Rated Optics.

The information contained in the publications is subject to change without notice.

## **GENERAL**

This product is a Safety Class 3 instrument. The protective features of this product may be impaired if it is used in a manner not specified in the user manual.

## **Environmental Conditions**

The TP-P6 is designed to operate at a maximum relative humidity of 95% and at altitudes of up to 2,000 meters. For more information, please refer to the Specifications section.

## **Before Applying Power**

Verify that the product is set to match the available line voltage, the correct fuse is installed, and all safety precautions are taken. Note: The PRO TP-P6's external markings are described under Symbols.

## **Do Not Operate in an Explosive Atmosphere**

Do not operate the PRO TP-P6 in the presence of flammable gases or fumes.

## **Do Not Remove PRO TP-P6 Cover**

Operating personnel must not remove test equipment covers. Component replacement and internal adjustments must be made only by qualified service personnel.

Any test equipment that appears damaged or defective should be made inoperative and secured against unintended operation until they can be repaired by qualified service personnel.

## **Safety Terms Used in This Manual**

### **Warning!!**

Denotes a hazard. It calls attention to a procedure which, if not correctly performed or adhered to, could result in personnel injury. Do not proceed beyond a Warning!! sign until the indicated conditions are fully understood and met.

### **Caution**

Denotes a hazard. It calls attention to an operating procedure which, if not correctly performed or adhered to, could result in damage to or destruction of part or the entire product. Do not proceed beyond a CAUTION sign until the indicated conditions are fully understood and met.

### **Note:**

Denotes information that may be beneficial during the use and maintenance of the PRO TP-P6.

## Laser Safety Announcements

### Warning!!

PRO TP-P6 is a laser device. Users should avoid looking directly into the optical output. The use of a fiber scope or magnifier should also be avoided. The use of such devices can focus a highly intense beam onto the retina, which may result in permanent eye damage.

Make sure that the optical fiber or cable is not in use and there is no laser light in the fiber before testing with the OTDR module. Failure to do so may result in an imprecise test trace, or even permanent damage to the PRO TP-P6.

### Caution

**Laser Radiation:** To avoid serious eye injury, never look directly into the optical outputs of fiber optic network equipment, test equipment, patch cords or test jumpers.

- Always avoid looking directly into the optical output port, when PRO TP-P6 is operational.
- Always replace protective dust cap on the detector port when PRO TP-P6 is not being used.
- Always avoid looking directly at unconnected end of optical fiber in testing and make the unconnected end pointing at a non-reflective object if available.

### Warning!!

- The AC/DC adapter should only be used indoors.
- The PRO TP-P6 should be well ventilated to avoid overheating.
- Never use electric tools near flammable gas or flammable materials.
- In order to avoid electric shock, please do not use the device if there is obvious damage on the outside (top cover, panel, etc)
- Only qualified repair personnel are authorized to perform adjustments, maintenance or repairs to the TP-P6.
- Even with the power off, the TP-P6 may still contain an electrical charge.


 
### Caution

**Battery:** The battery used in the PRO TP-P6 is a rechargeable lithium battery. If the TP-P6 is to remain unused for longer than two months, the battery should first be fully recharged before storage, and charged again before being placed back into service. Do not recharge the batteries for more than 8 hours. Do not take the batteries out without the assistance of a qualified repair technician. Do not expose batteries to fire or intense heat. Do not open or mutilate batteries. Avoid touching the electrolyte in the batteries, which is corrosive and can cause injury to the eyes, skin or clothing.

**External Power:** The PRO TP-P6 can be powered externally, using the supplied AC/DC charger/power adapter. For proper operation, the TP-P6 requires 24VDC.

## **How to Use This Manual**

**Button or Menu:** The operating units in the Graphical User Interface (GUI) that can be clicked by using the stylus are indicated by letters in square brackets, e.g. [Setup] and [Start].

**Key:** Function keys are on front panel, indicated by letter or icon in quotation marks, e.g.  (POWER) and  (LIGHT).

**Options:** Indicated by letters in brackets, e.g. {Event} and {Trace Parameter}.

**Tabs and Sub Options:** Indicated by letters in angle brackets and square brackets:  
e.g. <Mode> [Average], which stands for averaging mode option. <Wavelength> [1310nm], which stands for 1310nm wavelength option.

**Mode or Module:** Indicated by letters in quotation marks, e.g. "OTDR" and "OCI".

**Desired Selections:** Indicated by letter in quotation marks e.g. "Confirm" and "Cancel"

# Table of Contents

<b>1 General Information</b>	<b>10</b>
1.1 Scope of this Manual	
1.2 Unpacking and Inspection	
1.3 Introduction	
1.4 Product Appearance	
1.5 Front Panel Indicators Introduction	
1.6 Front Panel Keys Instruction	
1.7 Control Methods	
1.8 Instrument Interfaces Instructions	
1.9 GUI Icons Instruction	
1.10 Power the TP-P6	
1.11 Using the Li-Ion Rechargeable Battery	
<b>2 Basic Operation</b>	<b>19</b>
2.1 Foreword	
2.2 Power On/Off	
2.3 Enter and Exit "Power Saving" Mode	
2.4 Adjust LCD Brightness	
2.5 Launching an Application	
2.6 Installing a USB Keyboard or Mouse	
2.7 Printer Configuration	
<b>3 Common Settings and Special Settings</b>	<b>23</b>
3.1 Main Setup Menu	
3.2 Select language	
3.3 Automatic "Power Saving" Setting	
3.4 Recalibrating the Touchscreen	
3.5 Serious Deviation of Touchscreen	
3.6 Date and Time Settings	
3.7 Other Parameters Configuration	
3.8 Load Default Settings	
<b>4 Basic Information of OTDR Module</b>	<b>27</b>
4.1 Basic Principles of the OTDR Module	
4.2 Measurement Application of OTDR	
4.2.1 Measurement Capabilities of the OTDR	
4.2.2 Trace Analysis of OTDR	
4.3 Basic Definition and Classification of Events	
4.3.1 Events	
4.3.1.1 Reflection Events	
4.3.1.2 Non-reflection Events	
4.3.1.3 Inspection Events	
4.4 Optical fiber Span and Event Types	
<b>5 Instruction of OTDR Modules of PRO TP-P6</b>	<b>30</b>
5.1 Main Features of the OTDR Module	
5.2 Measurement Mode of OTDR module	
5.2.1 Auto Mode and Manual Mode	
5.2.2 Averaging Mode and Real-Time Mode	
5.2.3 In-Service Mode and Normal Mode	
5.3 OTDR Interface	
5.4 Icons in the OTDR Interface	
5.5 Trace Processing	

# Table of Contents

<b>6 Preparing to use the OTDR</b>	<b>34</b>
6.1 Connectors	
6.2 Cleaning and Connecting to Optical Fiber	
<b>7 Testing with the OTDR</b>	<b>35</b>
7.1 OTDR Quick Test	
7.2 Trace Processing	
7.3 Unsaved Traces	
7.4 Saving a Trace	
7.5 Auto Naming	
7.6 Opening a Saved Trace File	
7.7 Trace Viewing and Analysis	
7.8 Information and Function Windows	
7.8.1 Switch Information and Function Windows	
7.8.2 Events info reference	
7.8.3 Reanalyze	
7.9 Uploading a Trace to PC	
7.10 Get help While Using the OTDR	
<b>8 Testing Optical Fiber in “Auto” Mode</b>	<b>40</b>
8.1 Instruction of Auto Testing Mode	
8.2 “Auto” Testing Mode	
<b>9 Test the Optical Fiber in “Manual” Mode</b>	<b>41</b>
9.1 Common Parameters for OTDR Testing.	
9.2 OTDR Test Parameters Configuration	
9.3 OTDR Display and Other Configuration	
9.4 “Real-time” and “Averaging” Testing Modes	
9.5 Range Configuration	
9.6 Pulsetwidth Configuration	
9.7 Averaging Time Configuration	
9.8 Laser Wavelength Configuration	
9.9 IOR Settings	
9.10 Scatter Coefficient (Back scatter)	
9.11 Non-Reflection Threshold (Splice Loss Detection Threshold) Configuration	
9.12 Reflection Threshold (Reflection Detection Threshold) Configuration	
9.13 End Threshold (Optical Fiber End-Face Detection Threshold) Configuration	
<b>10 Using the OTDR to Test FTTx-PON Network Optical Fiber Spans</b>	<b>46</b>
10.1 Using the PON-Optimized OTDR Module	
10.2 Selecting the Proper Distance Range	
10.3 End Threshold (Optical Fiber End Detection Threshold)	
10.4 Test Parameter - Recommended Values	

# Table of Contents

<b>11 Trace and Event Analysis Settings</b>	<b>47</b>
11.1 Opening a Trace File	
11.2 Simultaneous Display MultipleTraces	
11.3 Closing Trace Files	
11.4 Trace Display	
11.5 Switching and Moving Markers	
11.6 Switching and Moving the Marked Point	
11.7 Quickly Moving the Markers Outside of the Window	
11.8 Locking the A/B Markers	
11.9 Zooming in on the Trace	
11.10 Cross Frame to Zoom-in on a Trace	
11.11 Using the Zoom Toolbar to Zoom	
11.11.1 Revert the Entire Trace View	
11.11.2 Zooming in Horizontally	
11.11.3 Zooming out Horizontally	
11.11.4 Zooming in Vertically	
11.11.5 Zooming out Vertically	
11.12 Automatically Remember the Zoom Status	
11.13 Move the Magnified Trace Window	
11.14 Setting the Event Options	
11.14.1 Locate and Display Events Within a Trace	
11.14.2 Add an Event	
11.14.3 Modifying an Event	
11.14.4 Deleting an Event	
11.15 Analysis Detection -Threshold Configuration	
11.16 Set the Analysis Detection Threshold	
11.17 Reanalyzing a Trace	
11.18 Analyze the Optical Fiber in a Specific Optical Fiber Span	
11.19 Set Trace Display Parameters	
11.20 Setting the Unit of Measurement	
11.21 Displaying or Switching Between Traces	
11.22 Checking the Current Trace Parameters	
<b>12 Manual Trace Analysis</b>	<b>65</b>
12.1 Using Markers	
12.2 Event Location and Loss Information	
12.3 Measuring Insertion Loss (2-Point and 5-Point Method)	
12.4 Measuring Attenuation (2-Point and LSA Method)	
12.5 Measuring Reflectance	
<b>13 Trace File Management</b>	<b>71</b>
13.1 Choosing a Format to Save a Trace	
13.2 To Copy, Move, Rename or Delete a Trace	
13.3 Checking the Available Disk Space	



# Table of Contents

<b>14 Print OTDR Report</b>	<b>73</b>
14.1 Reviewing Trace Information	
14.2 Checking and Editing Trace Information	
14.3 Printing an OTDR Report	
<b>15 VFL Application</b>	<b>77</b>
<b>16 Using the MPN Module</b>	<b>78</b>
16.1 Main Features of the MPN Module	
16.2 MPN Module Interface	
16.3 PON Power Meter of the MPN Module	
16.4 Stabilized Laser Source of MPN Module	
16.5 Optical Power Meter of the MPN Module	
16.6 Loss Testing with the MPN Module	
16.7 Optical Connector Inspection Using the MCI Module	
<b>17 File Management</b>	<b>87</b>
17.1 Transferring Files or Folders Between the PRO TP-P6 and a USB Storage Device	
17.2 Transferring Files or Folders Between the PRO TP-P6 and a PC	
17.3 Deleting Saved Files	
<b>18 Maintenance and Calibration</b>	<b>88</b>
18.1 Cleaning Optical Interfaces	
18.2 Necessity of Cleaning	
18.3 Safety Instructions for Cleaning	
18.4 Typical Cleaning Tools	
18.5 Cleaning Procedure	
18.6 Battery Charging Instructions	
18.7 Other Battery Information	
18.8 Charging the Battery	
18.9 Battery Calibration	
18.10 Changing the Battery	
18.11 Calibration Requirements	
18.12 Shipment	
<b>19 Troubleshooting</b>	<b>91</b>
19.1 Common Problems and Solutions	
19.2 Trace Measurement Problems and Solutions	
<b>20 Warranty</b>	<b>92</b>
20.1 Terms of Warranty	
20.2 Exclusion	
20.3 Warranty Registration	
20.4 Returning the TP-P6 for Service	
20.5 Customer Service Contact Information	

# 1 General Information

## 1.1 Scope of this Manual

Thank you for purchasing the Precision Rated Optics® TP-P6 test platform. Please read the user manual carefully before using any of the Precision Rated Optics® series fiber-optic equipment. Always observe the Warning!!s and cautions appearing throughout this, or any other user manual.

This manual contains the necessary information for the proper operation and maintenance of the Precision Rated Optics® PRO TP-P6.

All Precision Rated Optics® PRO TP-P6 platforms are carefully assembled and undergo a rigorous mechanical, electrical and optical inspection prior to shipment. Included with the PRO TP-P6, there should also be a data transfer cable, a power adapter, a PC Analysis software installation disk and this user manual. For detailed information, please refer to the packing list.

Upon receiving your PRO TP-P6, please check for any obvious signs of physical damage that may have occurred during shipment. Report any damage to the shipping agent or the representative of Precision Rated Optics immediately. Retain the original packing materials in case reshipment becomes necessary.

## 1.2 Unpacking and Inspection

This instrument has been carefully packed in accordance with standard shipping procedures. Examine the PRO TP-P6 for damage that may have occurred during shipment. If you find any damage or PRO TP-P6 is not operational, or if any of the included items are missing, please contact your nearest PRO representative:

**Precision Rated Optics, Inc.**  
***Product Distribution Center***  
***Manufacturing & Testing***

9999 Hamilton Blvd  
Breinigsville, PA 18031

Tel. (888) 545-1254

# 1 General Information

## 1.3 Introduction

The Precision Rated Optics® PRO TP-P6 Multifunctional Test Platform is a compact modular platform supporting various functions, including a Laser Source, Power Meter, bi-directional span loss testing, in-service PON OTDR testing, fiber termination inspection, visible fault locating etc. It is specially designed for FTTx/PON applications, and can meet all test requirements of installers, contractors and service operators during optical network installation, service activation, maintenance and troubleshooting.

PRO TP-P6 is easy to handle and features a large, color touchscreen, accurate adjustment knob (AKA “Jog Shuttle”) and an intuitive Graphical User Interface (GUI). The TP-P6 is compatible with Windows CE and has a large built-in memory, which allows for the storage of test data, manipulation of stored data, or transfer of stored data to a PC, via USB.

### Primary Features of the TP-P6


- 8.4” color LCD touchscreen, featuring adjustable brightness
- Convenient and flexible handling: touchscreen, adjustment knob, keypad and external USB mouse/keyboard.
- Data storage.
- USB data interface (Host and Client).
- PC software for test data analysis and reporting.
- Customizable screensaver feature for “Power Saving”.
- Optimized power management: 7 hours continuous operation.
- Direct printing through USB

### Optional Functional Modules

- OTDR Module (with VFL)
- OCI Module (Optical Fiber Connector Inspection)
- Multifunctional Module (Laser Source, Optical Power Meter and Optical Loss Tester etc.)


# 1 General Information

## 1.4 Product Appearance

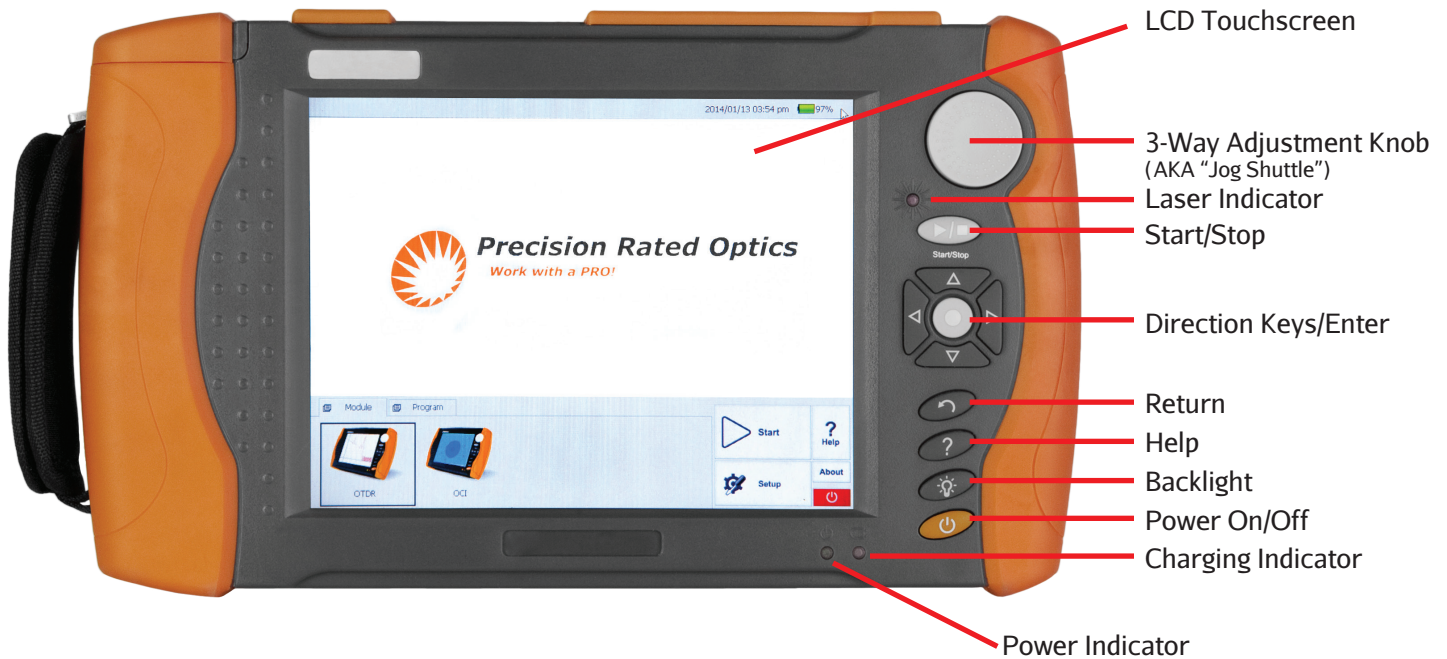

### Note:

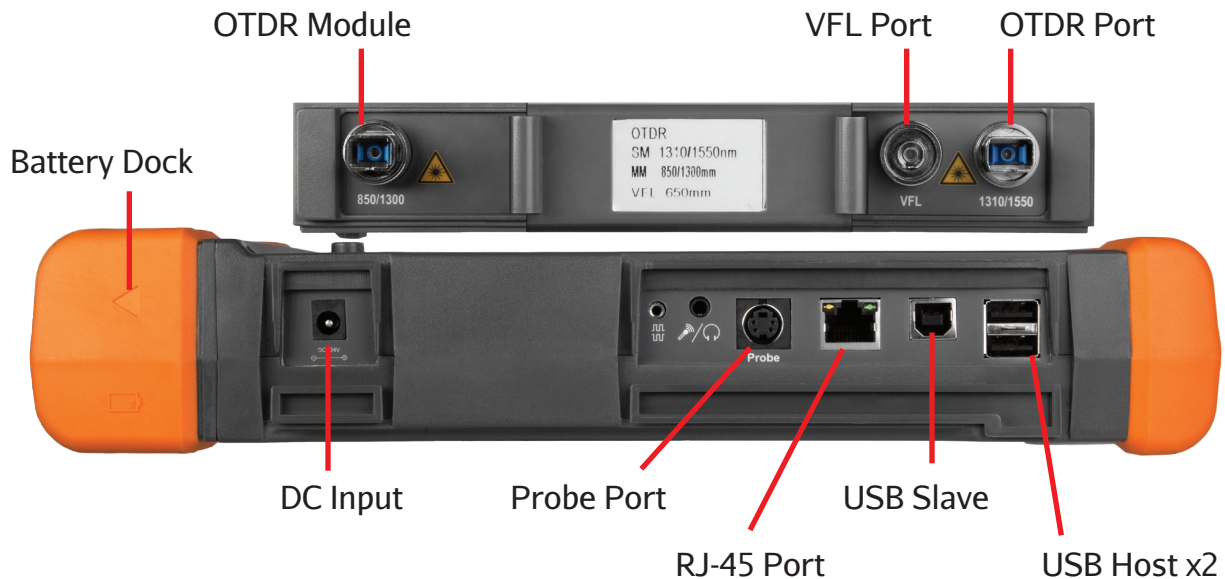


Power On/Off key is lower than other keys to avoid miss-operation.










### Top View

# 1 General Information

## 1.5 Front Panel Indicators Introduction

Icon	Status	Meaning
 Power On/Off	Off	System off
	Green, constant	System on
 Charging Indicator	Red, bspaning	Low battery, charging needed
	Red, constant	Charging with power adapter
	Red, bspaning	Low battery
	Green, constant	Charging complete, with power adapter
	Off	Power adapter unplugged or connection is poor
 Laser Indicator	Red, bspaning	Laser on
	Off	Laser off

## 1.6 Front Panel Keys Instruction

Name	Function
 Start/Stop	Press to start. Press again to stop.
	Launch selected module in main interface.
	Move up or extended function to be defined, please refer to Help of current interface.
	Move down or extended function to be defined, please refer Help of current interface.
	Move left or extended function to be defined, please refer Help of current interface.
	Move right or extended function to be defined, please refer Help of current interface.
•	Enter (Temporarily no function assigned)
BACK	Back
? HELP	Enter the Help section of the current interface.
 LIGHT	LCD brightness adjustment. 4-level brightness, press to toggle between different levels.
 POWER	Power on/off
	Press to power on system when system is off.
	When system is on, press and hold 1 second to enter "Screensaver" mode for lower power consumption. Press and hold 3 seconds to power off the system.
	In "Screensaver" mode, press any key and hold 1 second to restore normal status (Or by clicking anywhere on the touchscreen with the stylus, by clicking the mouse left key or the adjustment knob)

# 1 General Information

## 1.7 Control Methods

Name	Operation	Description
Stylus	Click	Select specific module or menu.
	Double click	All major test functions can be operated by stylus clicking.
	Draw frame	1. Batch files selection in File Explorer. 2. Zoom-in/out selected part of displayed trace.
	Click and hold	
Mouse (Optional)	Left click	Similar to stylus, more convenient for desktop application.
	Left double click	
	Left key draw frame	
	Right click	
Turning Knob	Up	OTDR quick operation.
	Rotate left	Move Marker left precisely.
	Rotate right	Move Marker right precisely.
	Down	Toggle between Markers/assisting points









 

 
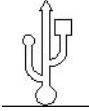
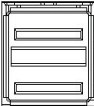
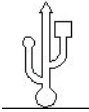

### Note:

- Sufficient pressure should be used, when using the stylus.
- The stylus should never touch the screen with too much force. Doing so may damage the touch-sensitive LCD screen.
- Please apply adequate force (not too much) with stylus on the touchscreen,
- Only use the included PRO TP-P6 stylus. Do not use any other object as a stylus. Sharp objects like a ball point pen may permanently mark or damage the touchscreen.
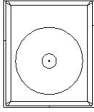
# 1 General Information

## 1.8 Instrument Interfaces Instructions

### Interfaces on Platform Top (Left to right)

Name	Appearance	Icon	Description
DC Input			Power adapter input
Serial Port			For system adjustment (Not open to user)
Audio Output			Headphone or audio output
Audio Input			Microphone input
RJ45 Port			10/100Mbps Ethernet port
USB Slave			Connection to PC for data transfer
USB Host			Connection to USB devices, e.g. printer, mouse, keyboard and USB interface testing devices (Driver needed)
Probe Port			Connection to the probe

# 1 General Information

## Optical Ports

The PRO TP-P6 is equipment with FC/PC connectors (Interchangeable SC, ST)

## Note:

The amount of connectors depends on the specific module configuration. Not all modules are equipped with all ports.

## Warning!!

Remember that the PRO TP-P6 is a laser instrument. Users should avoid looking directly into the optical output. The use of a fiber scope or magnifier should also be avoided. The use of such devices can focus a highly intense beam onto the retina, which may result in permanent eye damage.

## Caution









**Laser Radiation:** To avoid serious eye injury, never look directly into the optical outputs of fiber optic network equipment, test equipment, patch cords, or test jumpers.

- Always avoid looking directly into the optical output port, when PRO TP-P6 is operational.
- Always replace protective dust cap on the detector port when PRO TP-P6 is not being used.
- Always avoid looking directly at unconnected end of optical fiber in testing and make the unconnected end pointing at a non-reflective object if available.



# 1 General Information

## 1.9 GUI Icons Instruction

Icon	Status	Operation	Description
	Appear		Power adapter plugged
	Green part change		Showing battery power level with percentage behind.
	Appear		Battery unplugged or connection is poor.
		Click	Start selected function
		Click	Enter Setup interface, including Interface style, Language and System setting etc.
		Click	Enter Help of current interface
		Click	Enter Help of current interface
		Click	System off

## 1.10 Powering the TP-P6

### PRO TP-P6 uses following power supplies:


- AC adapter (Connect to standard outlet - Indoor use only)
- Li-ion rechargeable battery (Auto power supply when AC adapter is unplugged)
- Battery dock cover must be closed properly when PRO TP-P6 is operational.
- The AC adapter and battery power supply can be switched without affecting operation
- After the AC/DC power adapter is connected, the built in Li-ion battery will be automatically charged.

### When using the Li-ion battery as power supply, the following situations may cause the PRO TP-P6 to automatically power off or malfunction:

- The battery power indicator displayed on LCD screen will turn red (Low battery) when the battery power is insufficient. The PRO TP-P6 may then turn itself off.
- If unused for a long time, the PRO TP-P6 may not power on properly. If this occurs, please connect the power adapter and fully recharge the battery.

# 1 General Information

## 1.11 Using the Li-Ion Rechargeable Battery

- The battery for PRO TP-P6 is a Lithium Ion rechargeable battery.
- It requires approximately 4 hours to fully charge from a completely depleted state.
- When the PRO TP-P6 is charged by AC/DC power adapter, the  indicator on the front panel will turn red. It will turn green when charging is complete.
- When the PRO TP-P6 is powered on and being charged, the LCD will also indicate the charge status.

### Note:

If the TP-P6 is to be stored for a prolonged time, please charge the battery to 50%-70% before storing.

### Caution

Keep the battery away from fire or intense heat. Never open the unit, unless instructed to do so by a certified PRO repair technician.

# 2 Basic Operation

## 2.1 Foreword

This part introduces the basic operation on the PRO TP-P6. Please read this manual carefully for optimal operation. Should you encounter any problems during operation, you are welcome to contact the technical staff for assistance or more information.

## 2.2 Power On/Off

### Power on:

Press the  button until the LED power indicator is on.

### Power off:

Press the  button and hold 3 seconds until the LED power indicator is off.


### Note:

Power off will completely shut down the platform and all connected modules. Powering on will restart the platform, as well as all connected modules.


## 2.3 Enter and Exit “Power Saving” Mode

When the power is on, the user can set the PRO TP-P6 to “Power Saving” mode and return to normal status. In “Power Saving” mode, the LCD backlight will turn off.

### Two ways to enter “Power Saving” mode:

- Press the  button once to turn off the LCD backlight. The LED power indicator will remain on.
- When the power is on, the PRO TP-P6 will automatically enter “Power Saving” mode after its idle time exceeds the pre-set value (adjustable by user).

### To exit “Power Saving” mode you can:

- Press the  button
- Press any key on the front panel or the adjustment knob
- Click the touchscreen with the stylus
- Click the mouse

## 2.4 Adjusting the LCD Brightness

The LCD touchscreen has four (x4) levels of adjustment.

Press the  button to toggle between the different levels.


## 2.5 Launching an Application

When the PRO TP-P6 is first powered on, the system will load the main GUI. (See Fig. 2.1)


# 2 Basic Operation



## Launching the OTDR program

1. Select the "Modules" tab, then the "OTDR Module" in main menu. The module will be highlighted.
2. Click the  **Start** button to start the OTDR application.

## Launch "Multifunctional Module" or "Optical Connector Inspector" module applications

1. Select the "Modules" tab, then "Multifunctional Module" or "Optical Connector Inspector" module.
2. Click the  **Start** to launch the application.

## Note:

Application programs are only accessible onscreen while the module is connected. The TP-P6 will automatically detect when a module has been connected.

# 2 Basic Operation

## 2.6 Installing a USB Keyboard or Mouse

By default, there is a software-driven keyboard displayed onscreen. The user can select letter and numbers by using the stylus. To input large amounts of data, or simply to input data faster, a USB keyboard and/or mouse may be used

### Installing a USB keyboard or mouse on the PRO TP-P6

Connect the keyboard or mouse to the USB port. The USB port is on the top of PRO TP-P6.


#### Note:

- You do not need to power down the PRO TP-P6 before connecting the keyboard and mouse. The platform will automatically recognize the keyboard and/or mouse.
- The onscreen keyboard will still be displayed onscreen, even when the keyboard is connected.

## 2.7 Printer Configuration

To use a printer, it must first be configured in the user settings.

#### Procedure:

1. Connect the printer using the supplied USB cable, or another suitable cable.
2. Turn on the printer.
3. Enter the OTDR interface.
4. Click the  button on the lower-right corner of the screen. Enter the {Print} interface. (See Fig. 2.2)

## 2 Basic Operation

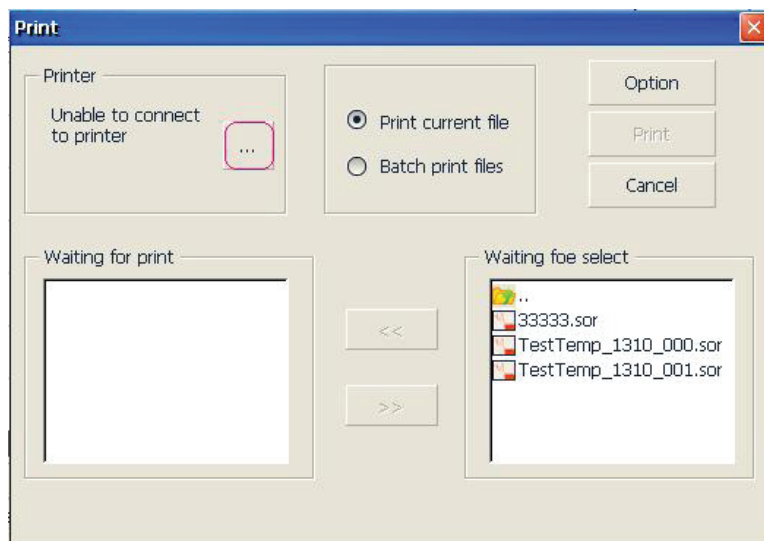


Fig. 2.2 Printer and setting interface

5. While in the {Print} interface, click the  button. The printer should be displayed. (See Fig. 2.3)

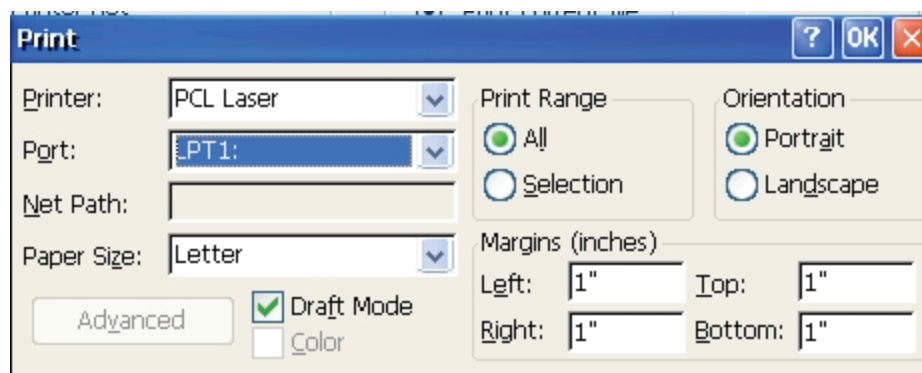


Fig. 2.3 Printer setting interface

6. In the printer list, choose your printer. Select "LPT1:" in the port list.

7. Select "OK" to finish the printer configuration.

### Note:

- The PRO TP-P6 only supports a USB printer with PCL language. Approved printers include the HP LaserJet 1022 and HP Laser P2015d, but others may be compatible as well.
- If the printer does not appear, remove the USB cable and reconnect the printer.
- You do not need to shut down the PRO TP-P6 when connecting the printer.

# 3 Common Settings and Special Settings

## 3.1 Main Setup Menu

In the Setup menu, the user can customize many settings, including the interface style, language , “Power Saving” mode, system settings, touchscreen calibration, etc.

### Enter [Setup] Menu:

After powering on, press the  **Setup** button to enter the [Setup] menu, as shown below:

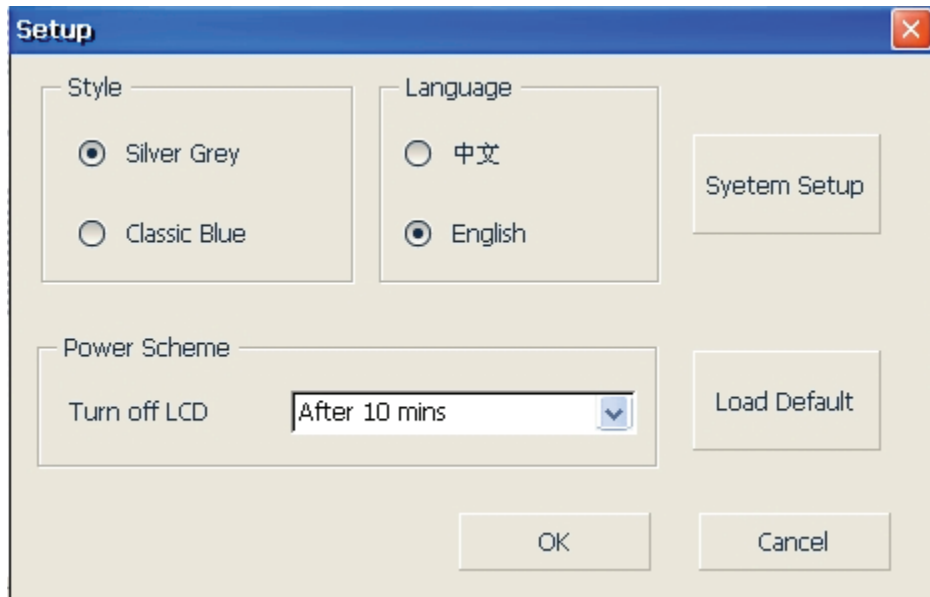


Fig 3.1 Setup Menu

# 3 Common Settings and Special Settings

## 3.2 Select language

### Switching Language:

1. Enter the [System Setup] menu.
2. In the language area, choose the desired language.
3. Press "OK" to confirm your selection.
4. You will need to power off and power on again for the chosen language to initiate.

### Note:


- After changing the GUI language and rebooting the platform, every function within the software will then be displayed in the desired language.
- At the time of this printing, English and Chinese are the only two languages offered.

## 3.3 Automatic "Power Saving" Setting

For prolonged testing sessions, it is suggested that you use the TP-P6 in "Power Saving" mode.

The PRO TP-P6 is designed to automatically enter "Power Saving" mode after its idle time exceeds pre-set value (adjustable by the user).

### Setting "Power Saving" Mode:

1. Click the  **Setup** button to enter into the [Setup] menu.
2. In the "Power Saving" area of setup menu, choose "Turn Off LCD."
3. Press "OK" to exit.

### Note:

"Power Saving" mode is on by default. The LCD backlight is programmed to turn off after 10 minutes of non-use.




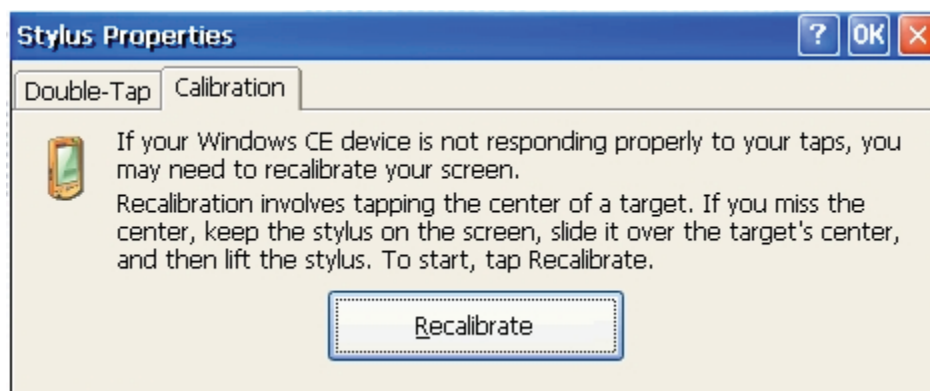
# 3 Common Settings and Special Settings

## 3.4 Recalibrating the Touchscreen

If the accuracy of the touchscreen seems abnormal, it is recommended that you recalibrate it.

### Recalibrating the Touchscreen

1. Click the  **Setup** button to enter into [Setup] menu.
2. While in the [Setup] menu, click [System Setup].
3. Double-click the “Stylus” icon.
4. Click [Calibration] and follow the onscreen instructions.



5. When the system shows “Press enter button to accept new setup,” click the touchscreen with the stylus to complete the new setting.

### Note:

The touchscreen can be calibrated as many times as required to achieve accuracy.

## 3.5 Serious Deviation of the Touchscreen

When the touchscreen is too far out of calibration, using the stylus may be difficult or even impossible. Alternatively, you can use a USB mouse to enter into the stylus [Calibration window], and continue calibration using a combination of the mouse and the stylus.

## 3.6 Date and Time Settings

The current date and time are displayed on the top-right of interface. When saving the test results, the files contain the date and time. This is called “Time/Date Stamping.”

# 3 Common Settings and Special Settings

## Note:

- The TP-P6 has a special internal battery to maintain the date and time.
- The internal battery is NOT servicable by the user.
- Modifying the time zone, date and time may affect some settings and operation of Windows CE.

## To set the time and date:

1. From the opening GUI, click [Setup], then [System Setup], then [Date/Time].
2. Modify the time and date.
3. Confirm the modification.

Exit the [Time/Date] interface.

## 3.7 Other Parameters Configuration

Though the “Control Panel,” Windows CE allows for changes to be made on a system level, which is beyond the scope of this manual. Please refer to your Windows CE information for further instructions.


## Note:

It is always suggested that you maintain the factory-set default system settings, unless it is absolutely necessary to change them.

## 3.8 Load Default Settings

This function is used to return the system settings to the factory defaults. These settings include: “Interface Style”, “Language”, “Power Saving” and OTDR features and settings.

## Load Default Settings:

From the main GUI, click the  **Setup** button.

Click on [System Setup] , then [Load Default]. You will then see “Restore factory settings?”

Click “Yes” to restore to factory default settings, or “No” to cancel.

## Note:

Keep in mind that restoring the TP-P6 to factory default setting will override any settings you have made, including preferences and saved trace data.

# 4 Basic Information of OTDR Module

## 4.1 Basic Principles of the OTDR Module

An OTDR (Optical Time Domain Reflectometer) is a measurement device for identifying optical fiber transmission problems. The PRO TP-P6 is mainly used to measure the attenuation of a whole optical fiber span, and to provide attenuation details relating to the length, location and characteristics of any event within the fiber optic span. An event can refer to faults caused by splicing, contamination, faulty connectors and/or bending in the fiber. The TP-P6 is non-destructive, and allows for one-end connection and rapid measurement during fiber manufacturing, construction, repair or general maintenance.

The faults and heterogeneity of optical fiber itself cause “Rayleigh Scattering” of light pulses transmitted in optical fiber. Part of the light pulse is scattered in the reverse direction of transmission, and is therefore called “Rayleigh Backward Scattering,” which actually provides attenuation details directly relating to the optical fiber length.

Information relating to the distance is obtained by measuring the time it takes for the light to return to the OTDR. That’s why it’s called an Optical TIME DOMAIN Reflectometer (OTDR). “Fresnel Reflection” occurs at the boundary between two media at a different Index of Refraction (IOR), which can occur due to macro bends, faulty connectors, dirty connectors or even by the other end (or “end-face”) of the fiber span. The reflection is used to locate any discontinuous points along optical fiber. The magnitude of reflection (strength) depends upon the difference between the IOR and the known characteristics of the transmitted light.

The OTDR sends a light pulse through the connected optical fiber, then identifies events by calculating the reflection, backward scattering and magnitude that occur within a specific time frame. The events are then displayed onscreen. The Y-axis is a decibel (dB value) of backward scattering power, and the X-axis is the distance from the user.

## 4.2 Measurement Application of OTDR

The OTDR displays power relating to distance of returning signals. This information can be used to identify the main properties of an optical fiber chain.

### 4.2.1 Measurement Capabilities of the OTDR

- Event location (Distance from user) or rupture of optical fiber span
- Attenuation coefficient of a fiber span
- Loss of a single event (e.g. one optic tie-in), or total loss
- Range of a single event, like reflection of connectors (or grade of reflection)
- Auto measurement of cumulative loss of a single event

### 4.2.2 Trace Analysis of OTDR

The trace analysis of OTDR is fully automatic. The trace locates:

- Reflection events of connections and mechanic tie-ins
- Non-reflection events (usually at spliced tie-ins)
- End-face of optical fiber

**Note:** By scanning the first loss event that is larger than the end threshold, the distance of the end of the optical fiber can be accurately calculated.

- Information provided: event type, loss, reflection and distance

# 4 Basic Information of OTDR Module

## 4.3 Basic Definition and Classification of Events

### 4.3.1 Events


Events refer to any abnormal points causing attenuation or sudden change of scattering power, besides the normal scattering of optical fiber, which include all kinds of losses, such as bending, connections and breaks.

Event points are displayed on the LCD and illustrate any event that prevents the trace from continuing in a straight line.

Events can be classified as either reflection events and non-reflection events.

#### 4.3.1.1 Reflection Events


When some pulse energy is scattered, reflection events occur. When reflection event occurs, peaks show on the trace, as shown below:

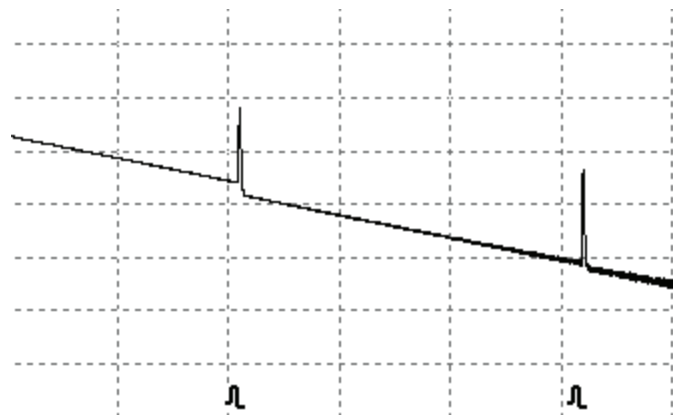

Reflection Event

#### 4.3.1.2 Non-reflection Events

Non-reflection events occur at certain points where there is some optical loss, but no light scattering. When a non-reflection event occurs, a power disruption is displayed on a trace.

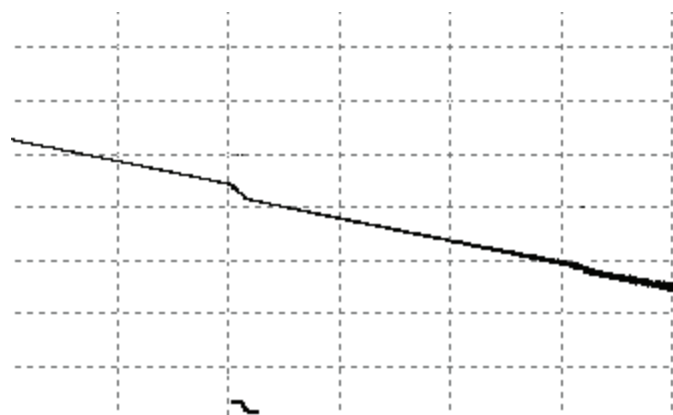

Non-reflection Event

 

 
 
# 4 Basic Information of OTDR Module

## 4.3.1.3 Inspection Events

The OTDR sends a light pulse into the optical fiber to be inspected. It then receives returning light signals and starts calculating the “event” distance. The farther the distance is, the longer the time needed for scattered light to be received by the OTDR. The event distance is then calculated.

Through inspection of scattered signals, properties of optical fiber, connectors, and tie-ins can be identified.

## 4.4 Optical Fiber Span and Event Types

Event Type	Description
	Beginning of optical fiber span
	Reflection event
	Non-reflection event
	End of optical fiber span

### Note:

The end of optical fiber can be identified through scanning the first loss event that is greater than the end threshold.

# 5 Instruction of OTDR Modules of PRO TP-P6

## 5.1 Main Features of the OTDR Module

- High dynamic range and short dead zones.
- Complete sampling under low noise. Accurate low-loss detection.
- Resolution accurate to within 10cm.
- Multiple test models to meet the requirements of any test condition.

## Caution

Always make sure that the optical fiber (or cable) is not “live,” and that there is no laser light in the fiber before testing with the OTDR. Failure to do so may result in an imprecise test trace, or even permanent damage to the OTDR.

## 5.2 Measurement Mode of the OTDR Module

For the ultimate in convenience, the OTDR module offers multiple measurement modes. These modes can be switched at any time.

### **5.2.1 Auto Mode and Manual Mode**

**Auto mode:** Calculate the length of fiber, setting Sampling parameters, getting and showing the trace and analyzing the events.

**Manual Mode:** Advanced Mode, whereby the user can set all OTDR parameters to test.

# 5 Instruction of OTDR Modules of PRO TP-P6

## 5.2.2 Averaging Mode and Real-Time Mode

**Real-Time Mode:** The OTDR will undertake a real-time measurement for the connector or exterior fiber and continually update the trace. While in “Real-Time Mode,” unless the user stops measuring, the OTDR will continue measuring.

**Averaging Mode:** Under “Averaging Mode,” the OTDR will average the data within the measurement time, which is set by the user. At the end of the designated measurement time, the OTDR will automatically stop measuring and display the final results of the trace.

### **Note:**

As a general rule, it is suggested that the user leave the OTDR in “Averaging” mode.

## 5.2.3 In-Service Mode and Normal Mode

**In-Service Mode:** Measures live fiber, using 1625nm to test.  
This mode does not affect the normal operational wavelength in the fiber under test.

**Normal Mode:** Uses wavelengths other than 1625nm (such as 1310nm, 1490nm, 1550nm and etc.).  
Before testing, please make sure there is no light present in the fiber under test.

### **Caution**

When using the “In-Service” mode, the fiber must be connected to the right port of 1625nm. If it is connected to other port, it may result in an imprecise test trace or even permanent damage to the OTDR.


### **Note:**

- The OTDR can only be in the “In-Service Mode” when the 1625nm wavelength is being used.
- When the OTDR is in “In-Service Mode,” other wavelengths (such as 1310nm, 1490nm, 1550nm etc.) are not available
- Both “In-Service” and “Normal Mode” can be used alternatively, but some modes are not available under certain conditions.

# 5 Instruction of OTDR Modules of PRO TP-P6

## 5.3 OTDR Interface

When powered on, the OTDR will show the main menu automatically. The platform automatically detects when an OTDR module (or any module) has been connected, and automatically enables the appropriate software to become accessible through the GUI.

In the main menu, select "OTDR Module", then click the  **Start** button to enter the OTDR user interface. (See Fig. 5.1)

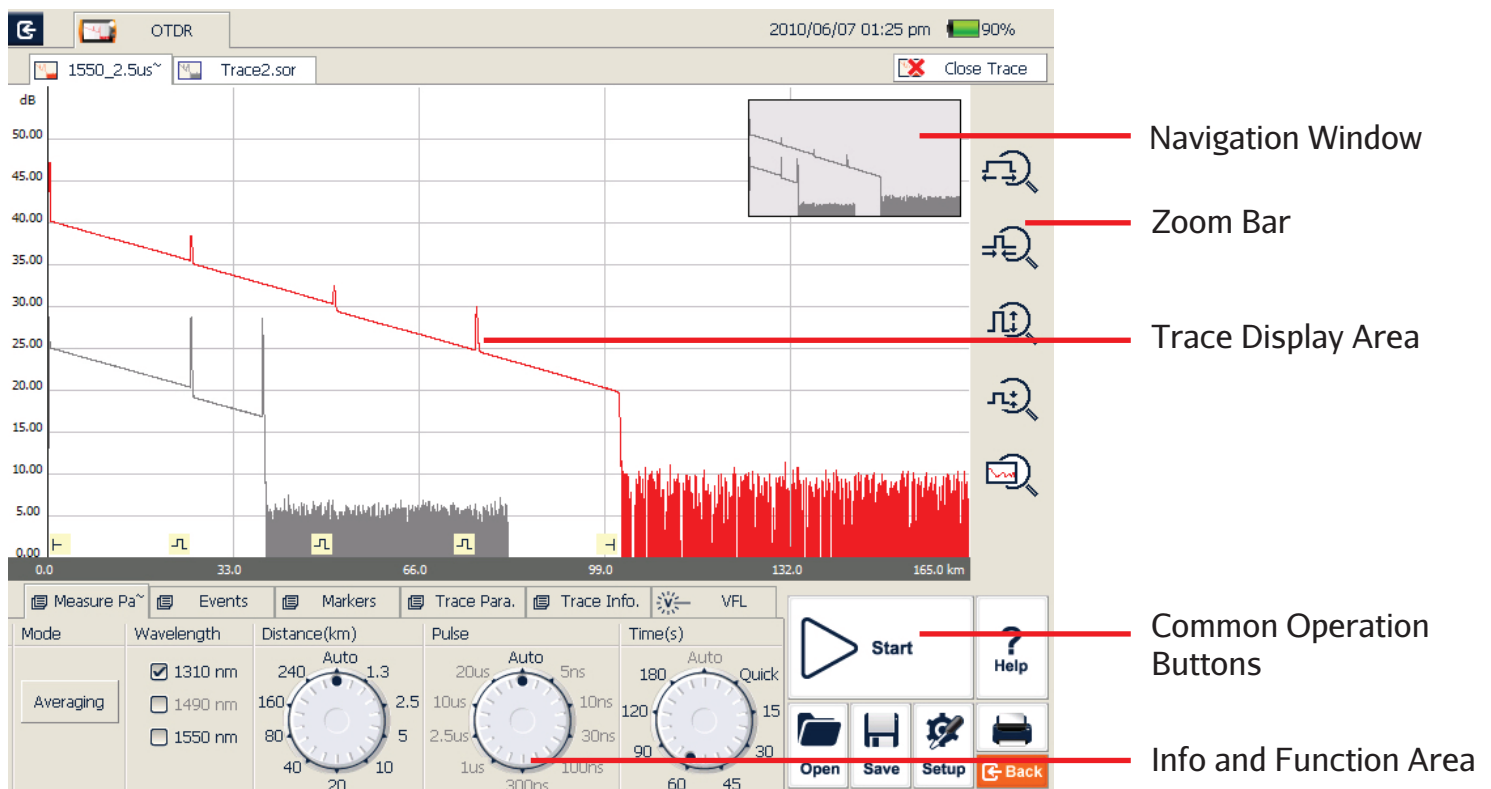


Fig 5.1 OTDR Main Interface








### Note:

 









The OTDR interface is available only when OTDR module has been attached.



# 5 Instruction of OTDR Modules of PRO TP-P6
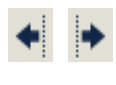
## 5.4 Icons in the OTDR Interface

Icon	Description
	Start testing
	Stop testing
	OTDR settings
	Save trace file
	Open trace file
	Print trace file
	Zoom-in trace horizontally

	Zoom-out trace horizontally
	Zoom-in trace vertically
	Zoom-out trace vertically
	Full-trace view
	A/B Marker switch
	Move Marker or marking point left/right
	Toggle between marking points
	Close trace
	Return to previous menu
	Return to previous menu

### Note:

Not all icons are displayed at one time. The icons become visible depending on which interface the user happens to be using at that moment.

## 5.5 Trace Processing

The “OTDR Trace Manager” software included with the TP-P6 is for trace review and analysis on a Windows-based PC, following trace acquisition. You can transmit the stored trace data be either connecting the TP-P6 directly to the PC, using the included USB cable, or by transferring the files using a USB “memory stick.

### Trace processing includes:

- Trace editing (single-trace, multiple-trace)
- Printing (single-trace printing, batch printing)
- Trace format conversion

The Bi-directional averaging program (for singlemode fibers only) is available in advanced versions. This is meant to increase loss testing accuracy by averaging the measured loss values of each event from both directions. Bi-directional testing is always recommended for the greatest accuracy.

# 6 Preparing to use the OTDR

## 6.1 Connectors

The TP-P6 comes standard with FC and PC optical port connectors. It can also accommodate SC and ST connectors, which are available from Precision Rated Optics.

## 6.2 Cleaning and Connecting to Optical Fiber

To ensure measurement accuracy, always clean and connect the fiber properly before testing. Tools are not required to connect fiber to the OTDR.

- Please refer to “Maintenance and Calibration” for optical port and connector cleaning.
- After cleaning the connectors, verify that the correct connectors are being used.
- Connect the fiber to be tested to the OTDR port.

### Note:

Improperly connected fiber can cause many problems, including highly innaccurate test results, caused by light loss and/or scattering.

### Warning!!

To ensure your personal safety, please refer to the Safety Instructions of this manual before testing.

### Caution

- When testing with the OTDR, unless connected to specific optical port, please make sure there is no operational laser in the fiber under test. Failure to do so may cause incorrect test results, or even permanent damage to the equipment.
- Please do not screw connectors too tightly, or damage may occur to the fiber and/or optical ports.

# 7 Testing with the OTDR

## 7.1 OTDR Quick Test

7.1.1 Check the connection between the fiber and the OTDR optical port, making sure they are properly connected.

7.1.2 Click the  **Start** icon, or press the  button to start testing.



7.1.3 Click the  **Stop** icon, or press the  button to stop testing.

Fig 7.1 Shows the interface after a trace acquisition:

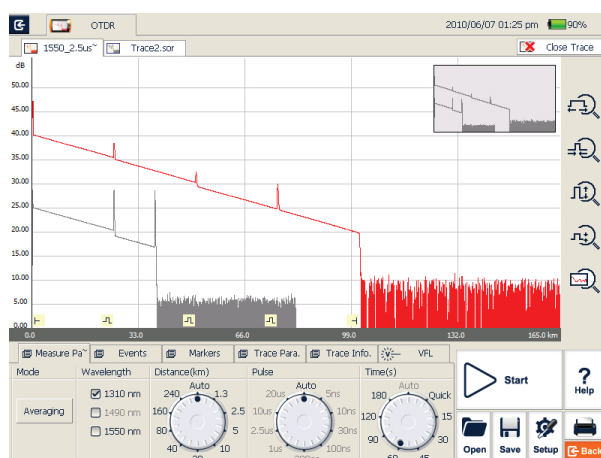


Fig 7.1 OTDR Trace Acquisition Interface

### Note:

- During testing, the averaging trace shows in the trace display area and refreshes at certain intervals. The trace result are displayed immediately following the final trace.
- The user can stop tracing at any time. If stopped, the application will display all trace information gathered up to that point.
- After a trace analysis is complete (or manually stopped by the user) the system will perform automatic trace analysis. The analysis usually takes about 5 seconds or less, after which the user can initiate a new trace.
- In Averaging Mode, the interface will display the remaining time of the trace.
- In “Real-Time” mode, the trace will keep going until the user manually stops it.

## 7.2 Trace Processing

After tracing and automatic analysis is complete, the event types will be displayed below the trace area. The user can review all of the events’ information in the events list, which can be viewed through the {Events} tab. The user can also save traces, open saved traces to review, or initiate a new trace.

### Note:

The application will prompt the user to save unsaved traces before initiating a new trace.

# 7 Testing with the OTDR

## 7.3 Unsaved Traces

Unsaved traces will be titled as “\*U\_xxxx” (xxxx stands for the current testing wavelength), which is displayed on the upper-left corner of the trace display area.



### Note:

A trace name starting with an asterisk: “\*” indicates that it is an unsaved trace or a modified trace.

## 7.4 Saving a Trace

When a trace is complete, the user can save the trace, along with the parameters information.

### Procedure:

1. Click the  button on the lower-right corner of the main interface and the [Save File] dialog window will pop up.
2. File Format: The user can choose a file format, such as “.sor” or “.jpg”.
3. The user can click the  button on the top-left of the [Save File] dialog box to select a specific target directory.

The user can also click  to create new folder.

4. The user can edit the name of the file to be saved. All characters are allowed.
5. File saving: In the [Save File] dialog window, click the [Save] button to save the file.
6. Click [Cancel] to cancel saving the file.

The [Save File] dialog window and options are shown below. (See Fig 7.2)

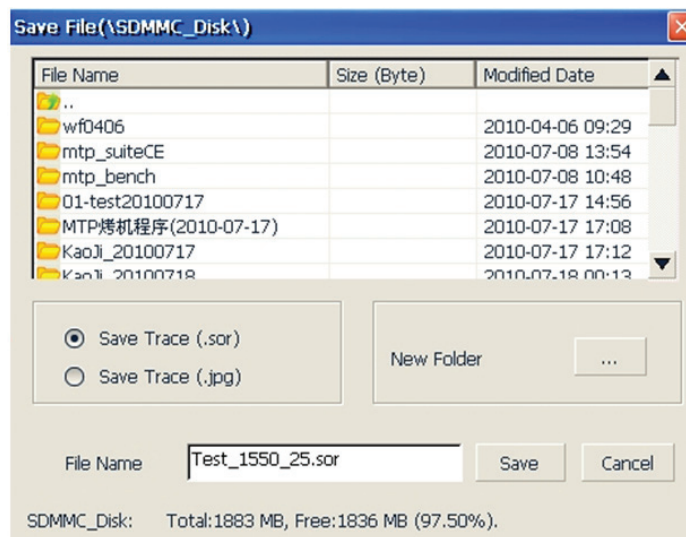


Fig 7.2 Save dialog window

# 7 Testing with the OTDR

## Operation Notes:

- The title bar will always show the current folder path, as shown in Fig 7.2: “\SDMMC\_DISK\”.
- Newly created folders will automatically be displayed.
- After a file is saved, the file name will be displayed on the upper-left corner of the trace display area. **Please Note:** Only the first 10 characters of the file name will be displayed. The remaining characters are abbreviated using a tilda “~” mark

## 7.5 Auto Naming

The system supports automatic naming when saving traces.

### Procedure:


1. Enable/disable “Auto Naming” by checking or unchecking {Auto Naming} in the OTDR Setup.
2. The user can edit the auto naming default filename by modifying file name prefix from the {File Name} field.

**Please Note:** The prefix is only available when the “Auto Naming” option is checked.

### Note:

- The file name in “Auto Naming” mode consists of the Prefix+Wavelength+Number. The number will increase automatically as the user continues to save traces.
- If the name of the file to be saved already exists, the system will display a Warning!!.

## 7.6 Opening a Saved Trace File

Click the  button on the lower-right corner of the OTDR interface to open a saved trace.

1. In [Single -Trace Display] mode, when opening a new trace, the currently-displayed trace will be closed.
2. In [Multiple-Trace Display] mode, the user can simultaneously display up to four traces.

### Note:

- The user can enable or disable “Multiple-Trace Display” mode in the OTDR setup by checking or unchecking the {Multiple-Trace} option in the [Display] dialog.
- The user can open and view a “.jpg” format trace through “File Explorer” on the {Program} tab in the main interface. The “.jpg” format trace can be also loaded onto a PC for viewing and analysis.

## 7.7 Trace Viewing and Analysis

The user can zoom-in or out of a trace by utilizing Markers and marking points for the trace characterization, including loss, attenuation, reflection, etc.

### Zoom in or Zoom out of a trace:



- To zoom in: Draw a selection frame from the upper-left corner to the lower-right right corner.
- To zoom out: Draw a selection frame from the lower-right corner to the upper-left corner.

# 7 Testing with the OTDR

## Show A/B Marker:

- Click the {Markers} tab in the OTDR main interface and the Markers or Marker tabs will show in the trace display area.
- Press the adjustment knob once.



## To move the Marker quickly:

- Select and hold the Marker, dragging it to the left or right.
- Alternatively, click the  or  buttons on {the Markers} tab to move the active Marker left or right at an accelerated speed. This is especially useful for extremely long-distance traces.

## Moving the Marker precisely:

- Rotate the adjustment knob clockwise to move the Marker right.
- Rotate the adjustment knob counter-clockwise to move the Marker left.

## Switching from the “A” Marker to the “B” Marker:

- Click the  or  button to switch the A/B Markers from the {Markers} tab.
- Alternatively, press the adjustment knob once to switch.
- Alternatively, click the desired Marker with the stylus or mouse.


## Note:

- When holding and moving the Marker with stylus, please apply adequate force, or the operation may not be successful. **As with anything, using the touchscreen and stylus quickly and efficiently may take some practice.**
- Marker movement and re-analysis are not applicable when viewing a '.jpg' format trace. A .jpg is essentially a flat “snap shot” of the trace, not an actual live, real-time trace.

## 7.8 Information and Function Windows

The information and function windows are located at the bottom of OTDR interface.

**Information can include:** event list, measurement parameters, Markers information (A/B Marker, marking points, etc.), trace parameters and trace information.

Tab	Function
Meas. Para.	Measurement parameters: Mode, Wavelength, Range, Pulse width, Averaging Time and etc.
Events	Add event, modify an event, delete an event and analyze an event.
Markers	A/B switching, moving Markers, locking, loss and reflection analysis.
Trace Para.	Trace test parameters
Trace Info.	Cable and fiber information viewing and editing.
 Source	OTDR module built-in visible light source.

# 7 Testing with the OTDR

## 7.8.1 Switch Information and Function Windows

At any time, the user can switch to a different tab or window simply by clicking it with the stylus.

## 7.8.2 Events Info Reference

Within any interface, while using any module or function, the user can simply click the ▲ or ▼ buttons to scroll through the events, then click on a specific event and the detailed information relating to that event will be displayed.

## 7.8.3 Reanalyze

If the trace data does not provide the required information, or unexpected results are obtained, you may perform a new trace at any time.

### **To reanalyze a trace:**

1. If necessary, review or reset the threshold.
2. In {events}, click [analyze]. The system will reanalyze the trace.
3. When the analysis is complete, the events list will show the new results.

### **Note:**

- Reanalyzing a trace may cause certain previously detected events to be deleted. The ability of the TP-P6 to detect events depends largely upon the threshold setting at the time the trace is initiated. Events that occur outside of the given threshold will not be detected.

## 7.9 Uploading a Trace to a PC

Once transferred to a computer, the trace data can be analyzed, stored and manipulated in many ways. This is particularly useful when performing fiber characterization.

### **To copy or move the trace to a computer:**

1. The user can copy the saved trace to a computer by connecting it directly using the supplied USB cable, or by using a “thumb” drive, or similar USB storage device. The trace data can then be analyzed using network management, such as FiberBase, which is also available through Precision Rated Optics.

Note: Any USB “thumb” drive can be used for the transfer of data from the TP-P6 to the computer.

## 7.10 Get Help While Using the OTDR

While using the OTDR module, click “?” or “HELP” to display detailed information. Click “BACK” to exit.

# 8 Testing Optical Fiber in Auto Mode

## 8.1 “Auto Testing” Mode

When the total length of a fiber span is unknown, the user can simply use the “Auto Testing” function to acquire the trace and analyze any events found.

While in “Auto” mode, the OTDR will automatically estimate the optical fiber length, set the sampling parameter, obtain the trace, and display the resulting events in the form of a list.

While in “Auto” Mode, the user can specifically set the desired parameters, such as:

- The wavelength to be used for testing (at least one wavelength)
- Testing time span

### Note:



If “Auto” mode is used, the TP-P6 analyzes the connected fiber, then calculates the setting that best fits the required test(s) to be performed. This automatic calibration generally takes under five (x5) seconds. If the fiber is removed during that time, or the operation is aborted, no test data will be displayed.

### Caution

Except for the fiber under test, do not connect any optical fiber which sends any additional optical signal to the OTDR port. Any external signal over -30dBm will not only affect the OTDR sampling (providing inaccurate results), but could also permanently damage the OTDR.

## 8.2 “Auto” Testing Mode

To test and acquire a trace in “Auto” Mode:

1. Connect the optical fiber to the right OTDR light port.
2. Set the parameter “Range” to “AUTO”.
3. Set the testing time span.
4. **To initiate testing:** Using the stylus, click the  icon, or press the  (Start/Stop) button on the front panel.
5. When the trace is complete, you may save the trace, review the trace or re-analyze the trace. If you need to re-analyze the trace, please follow the steps as outlined above until a satisfactory test has been performed.

### Note:

- When testing automatically, please remember to set the “Range” to “AUTO.”
- When setting the parameters, take into consideration the overall condition, cleanliness and complexity (number of connections points) of the fiber under test. Failure to do so may result in highly inaccurate test results.



# 9 Test the optical fiber in Manual mode

“Manual” mode can be used to set various test parameters more precisely. if you are quite familiar with the fiber being tested, setting the parameters precisely can achieve even greater testing accuracy.

Setting the parameters correctly is essential to achieving the most accurate results.

## 9.1 Common Parameters for OTDR Testing.


You can set the parameters {Meas. Para.} from the [Options] section of the OTDR [Settings] dialog. Please remember that these parameters and settings are only available if there is an OTDR module connected to the TP-P6.

Parameter	Definition
Range	The overall distance of the fiber span
Pulsewidth	The width of the laser pulse being transmitted by the Light Source port of the OTDR module.
Averaging Time	User-selectable testing time.
Wavelength	Laser wavelength, testing laser wavelength selection
Mode	Defines which mode the OTDR is using, i.e., “Manual” , “Auto”, etc..

Table 9.1 OTDR common use parameters table

## 9.2 OTDR Test Parameters Configuration



Click the [  Setup ] icon (from within the OTDR interface) to enter the settings window. From here, testing parameters can be set by the user, including: General Settings, Analysis Parameters Settings, etc.

Parameter	Definition
IOR	IOR of optical fiber, which affects the transmission speed of a laser. Need to set separately accord to operational wavelength relatively
Scatter Coefficient	Also known as “back scatter,” affects the power of the laser on any given fiber span.
Non Reflection Threshold	Also known as “splice loss,” threshold. Non reflection events with insertion loss greater than the threshold will be displayed on the trace.
Reflection Threshold	Also known as “reflectivity.” Reflection events with insertion loss greater than this threshold will be displayed on the trace
End Threshold	Also known as optical fiber-end detecting threshold. The first event with insertion loss greater than this threshold is identified as the end of the fiber, and all following events will be ignored on trace.
Default	Revert to the values set by the factory. This will erase all user-adjusted settings.

Table 9.2 OTDR test parameters setting table

# 9 Test the optical fiber in Manual mode

## 9.3 OTDR Display and Other Custom Configurations



The saving method, testing display area and etc. Parameters setting in this part won't affect the testing result.

Setting	Content
Auto Name	If this is selected, the trace files will automatically be named. The file name will be determined by the information obtained by that test, and used as the prefix for the naming of that file.
Display Grid Line	If this option is selected, the grid lines will be displayed while the trace is being displayed.
Support Multiple Traces	If this option is selected, multiple traces can be displayed simultaneously.
Navigator Window	If this option is selected, there will be a trace navigator window on the upper-right of the trace window. This makes it easier to ascertain the overall state of an entire trace. Through the "Navigator" window, you can also zoom-in on a trace.
Display the Zoom Toolbar	If this feature is selected, a zoom toolbar will appear onscreen and the overall size of the trace onscreen will be smaller to allow for the extra window. If this feature is not selected, the toolbar will not appear, increasing the trace size onscreen.
Length unit	The user can select either American standard or metric units as the default.

Table 9.3 OTDR display and other options

## 9.4 "Real-time" and "Average" Testing Modes

Under sampling and accumulating conditions, test mode has real-time and average modes.

1. Under "Real-Time" mode, The TP-P6 tests the external optical fiber connection in real-time and refreshes the display. When the user clicks the  icon, or the  (Start/Stop) icon on the front panel, the test will either be stopped or restarted, depending on the status at that moment.
2. Under "Average" mode, the TP-P6 accumulates and averages the testing data according to the time range set by the user. When testing is complete, the results are displayed onscreen.

Under normal circumstances, the "Average" mode will suffice for most testing.

### Operating Instructions

- "Real-time" and "Average" modes are controlled by [Real-time/Average] in {Test Setting} <Test Mode>
- While in <Test Mode> clicking the adjustment knob will switch between the two options.

# 9 Test the optical fiber in Manual mode

## 9.5 Range Configuration

Setting the range as close as possible to the actual length of the fiber under test will result in far greater accuracy when testing.

Range Options: Auto, 1.3km, 2.5km, 5km, 10km, 20km, 40km, 80km, 160km, 240km, etc.

### Operation:

Select the range desired.

### Note:

- If the user selects “Auto” for the test range, the OTDR will attempt to determine the range automatically. It will also automatically choose a pulse width.
- By default, the OTDR module is set to “Auto.”

## 9.6 Pulse Width Configuration

Pulse width selection affects the trace dynamics and resolution. Selecting a smaller width to test can achieve a higher distance resolution and smaller dead zone, but it affects the dynamics. Conversely, selecting a wider pulse width can achieve higher dynamics, and can be used to test longer distances, but will affect the resolution and dead zone.

### Operation:

Select the pulse width value.

### Note:

- Default value: Auto
- When the distance range is “Auto”, the pulse width will also be automatically determined. The pulse width will adjust itself according to the distance range.

## 9.7 Averaging Time Configuration

Test times affect the test trace Signal-to-Noise-Ratio (SNR). The longer the test time, the higher the SNR and the greater the dynamics. Consequently, when testing long-distance optical fiber, select a longer test time to achieve greater resolution and accuracy.

### Operation:

Click the time span duration in the time span area of [Settings].

### Note:

- Averaging Time Options: Auto, Quick, 15s, 30s, 45s, 60s, 90s, 120s, 180s, etc.
- The factory default value is 60 seconds.

# 9 Test the optical fiber in Manual mode

## 9.8 Laser Wavelength Configuration

The user can select the wavelength to be used for testing, or can select multiple wavelengths to be used simultaneously.

### Operation:

Select the desired wavelength in the “Wavelength” parameter in [Setup].

### Note:

The available wavelengths will be determined by which module(s) are attached and being used.

## 9.9 IOR Settings

IOR is a key factor in determining the speed of the laser transmission in optical fiber. The IOR configuration has a direct impact on the accuracy of the measurement. Generally speaking, the IOR parameter is a recommended value, provided by the optical fiber manufacturer. The value can be set to an accuracy of four decimal places, between 1.0000 and 1.9999.

## 9.10 Scatter Coefficient (Back Scatter)

Scatter coefficient determines the value of backward scatter power. The configuration affects the calculation of reflection value.

### Note:

The configuration zone is: -10 to -70dB.

## 9.11 Non-Reflection Threshold (Splice Loss Detection Threshold) Configuration

This configuration has a direct impact on the listing of insertion loss events. Only events greater than this threshold will be listed. The threshold range is from 0.00 to 5.00dB.

### Note:

The default value is 0.20dB.

# 9 Test the optical fiber in Manual mode

## 9.12 Reflection Threshold (Reflection Detection Threshold) Configuration

This configuration has direct impact on reflection events listing. Only reflection events greater than this threshold will be displayed in events list. The threshold range is from -10dB to -65dB

### **Note:**

The default value is -52.00dB

## 9.13 End Threshold (Optical Fiber End-Face Detection Threshold) Configuration

This threshold is the end-face threshold of optical fiber. If the end-face threshold equals 3.0dB, then the first event with insertion loss greater than 3dB will be considered as the end of the optical fiber. The available values are between 0.0dB to 20.0dB.

### **Note:**

The default value is 3.00dB.

## 9.14 Load Default

In the OTDR Setup interface, there are three “default” options. Each option corresponds to scatter coefficient (back scatter) non-reflective events’ thresholds:

- 1) Splice Loss Detecting Threshold
- 2) Reflection Threshold (reflection detecting threshold)
- 3) End Threshold (optical fiber end detecting threshold).

# 10 Using the OTDR to Test FTTx-PON Network Optical Fiber Spans

FTTx-PON network optical fiber spans are different from normal optical fiber spans. There is a branching aspect to the span. The user needs to be aware of the following, when testing FTTx-PON:

## 10.1 Using the PON-Optimized OTDR Module

Some models are optimized specifically for testing FTTx-PON network optical fiber spans, and can achieve highly accurate trace results.

Due to the higher sensitivity, it is important to correctly set the distance range, end threshold (optical fiber end detecting threshold) and reflection threshold (reflection detecting threshold).

## 10.2 Selecting the Proper Distance Range

Because there is branching in FTTx-PON network optical fiber spans, there will be significant attenuation, resulting in inaccurate automatic calculation of the span's length. We therefore highly recommend manually selecting the parameters, such as the distance range, pulse width and other thresholds.

## 10.3 End Threshold (Optical Fiber end Detection Threshold)

For normal optical fiber spans, the end threshold configuration can remain set at 3.0dB. For PON network testing, however, the user will need to set the end threshold to a proper value, then the PRO TP-P6 can locate the end accurately. Please refer to Table 10.1 (shown below) as a reference.

## 10.4 Test Parameter - Recommended Values


Splitter Type	Loss Reference Value	End Threshold Configuration Reference Value	Recommended Test Pulse Width
1:8	$\geq 9\text{dB}$	12dB	100ns, 300ns
1:16	$\geq 12\text{dB}$	15dB	100ns, 300ns
1:32	$\geq 15\text{dB}$	18dB	300ns, 1us
1:64	$\geq 18\text{dB}$	21dB	300ns, 1us

Table 10.1 Recommended parameter values for PON network optical fiber spans

# 11 Trace Analysis and Event Operation

## 11.1 Opening a Trace File

### To open a file:

1. Select the  icon from the OTDR interface.


2. Select the file you wish to open.

**Note:** If necessary, click the scroll bar on the right side to scroll through the list of saved files.

3. Click [open] and the file will open and be displayed onscreen.

**Note:** To exit the file search, simply press “Cancel.”

4. The file name is always displayed on the upper-right side of the screen.

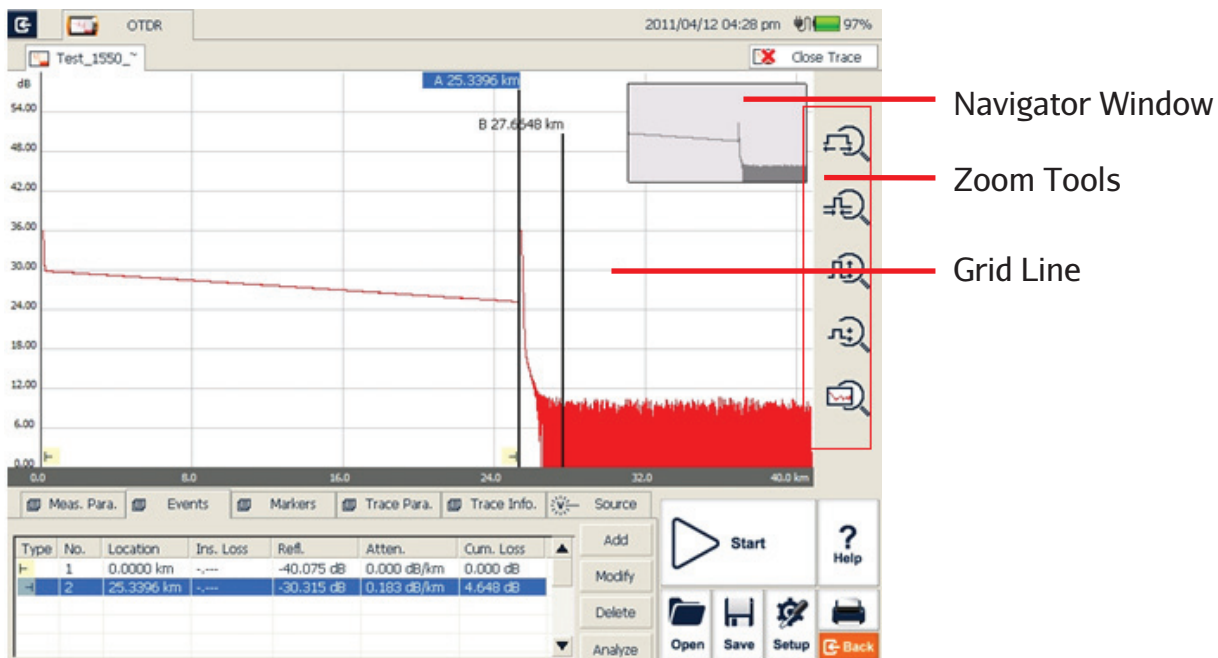

### Note:

- A bi-directional trace file is too large to be displayed on the TP-P6's built-in screen. To view a bi-directional file, simply use the data analysis software, which is included with your TP-P6.


# 11 Trace Analysis and Event Operation

## 11.2 Simultaneous Display Multiple-Traces

For the purpose of comparing trace files, the PRO TP-P6 supports the opening and displaying of multiple traces simultaneously. When opening multiple traces, the current trace is shown in **red**, the icon in front of the file name is also **red**. The other icons are grey.

The user can choose whether to display a single trace or multiple traces.

### Opening “Multiple Traces”:

In the OTDR  in the test options, select the “Support Multiple Traces”.

### Note:

The TP-P6 can simultaneously display (x4) traces on the built-in screen. If the user needs to examine other traces, please close some of the opened traces, or upload the trace data files to a PC and use the data analysis software.

## 11.3 Closing a Trace File

Click the [Close Trace] button on the upper-right corner of the interface to close the trace file.

### Note:

While in “Single Trace” mode, selecting “Open New Trace” will automatically close the currently displayed trace automatically.

## 11.4 Trace Display

After a trace has been opened, the TP-P6 will display the trace and analysis result in the trace window. The events on the trace will be marked by small icons. These events will be marked and displayed below the corresponding trace.

**Note:** The X axis shows the relative distance from the testing point.

**Note:** The number on the Y axis shows the reflection power value (relative power) and its range.

**Note:** After acquiring the trace, the trace display parameters can be revised (such as grid lines and the “Zoom Window” screen).

### Note:

The contents of the trace window change according to the selected options. Some items of a trace can be seen simultaneously on the built-in screen, but other items are displayed only when they are selected for display. The TP-P6 will automatically display as much information as possible on the built-in screen, depending on the user settings and available screen space.



# 11 Trace Analysis and Event Operation

## Event Options:

In {event} options, there are various parameters of events listed, including **event type, number, position, insertion loss, reflection loss, attenuation and accumulation**.

When switching to {event}, the TP-P6 will display a Marker on the tracing graph.

When a particular event in event list is selected, the Marker will move to that event position.

When opening multiple traces, the event options only displays the current trace.

## Markers Options







When altering {Markers} options, the TP-P6 will display two Markers: A and B, or include some reference points.

The user can move these Markers along the trace, to calculate loss, attenuation, reflection, etc.

The user (from the “Markers” settings interface) can relocate all Markers at once, and also drag them from within the trace display window. The adjustment knob can be used to move the Markers very precisely. If the user requires the maximum degree of control over the Markers, it may be necessary to zoom-in on the area containing the Markers to achieve precise movement.

## 11.5 Switching and Moving Markers

There are several ways the user can alternate between and move Markers. The user can use a combination of methods to achieve maximum efficiency when navigating through a trace.

- In the trace display area, use the stylus or mouse to select the A/B Markers, or the tab above the Markers.
- In the buttons area on the bottom of interface, click  or  to switch between A and B.
- Press down the spinning-hand wheel (on the front panel) to switch between the Markers, or mark a particular point.
- After selecting Markers, continuously click the  or  buttons to move the Markers.
- The spinning-hand wheel on the front panel can be used to move the Markers more precisely.
- After selecting the marked point, click the  or  buttons to move the Markers to the left or right.

## Note:

- For easier usage, the position of the Markers will be stored in memory - even when the unit is turned off. When the TP-P6 is turned back on, the user will see the last known Marker positions on the trace appear automatically.
- A marked point appears anywhere on the fiber span where a loss or reflection event has occurred.
- The spinning-hand wheel can move the Markers accurately, but it can be very slow if the trace is particularly long.




# 11 Trace Analysis and Event Operation

## 11.6 Switch and Move the Marked Point

When analyzing loss or reflection events, there will be marked points displayed for additional testing to be performed near the selected Markers.

There are various ways to switch or move the marked point(s). The user can use one or all of them to increase efficiency.

To move Markers, you may:

- Use the stylus or mouse to select a Marker, then click and drag the marked point to a new desired location along the trace.
- In the buttons area of the interface, click the  icon to switch between the available Markers.
- Press down the spinning-hand wheel on the front panel to create a new marked point.
- After select the point, continuously click the  or  to move the point.
- Use the spinning-hand wheel to move the marked point accurately.

### Note:

When moving points associated with each Marker, please keep in mind:

- The marked points on the left side cannot cross the Markers on the right side.
- The marked points on the right side cannot cross the Markers on the left side.

## 11.7 Quickly Moving the Markers Outside of the Window

When magnifying a trace, the Markers may be positioned outside of the window.

When the Markers are on the left-side (outside the window) there will be an indicator on the left margin of the window: **A <--** or **B <--**.

When the Markers are on the right-side (outside the window) there will be an icon on the right margin of the window: **--> A** or **--> B**.

Clicking and dragging the indicators shown above can move the Markers into current window.

# 11 Trace Analysis and Event Operation

## 11.8 Locking the A-B Markers

In the {Markers} interface, select the [A-B] to linked the A and B Markers.

After the A and B Markers are linked, when moving one Marker, the other one will move with it, and the distance between them will remain the same.

For some special testing operations, this function may be useful.

### Note:

When one Marker is moved to the trace boundary, the distance between A and B will not be maintained, but will revert when it's not contained within the trace boundaries.

## 11.9 Zoom-in on a Trace

In order to examine an event in greater detail, from within a trace, zooming-in can be useful.

The TP-P6 provides two ways to zoom-in on a trace:

Method #1: Zoom-in by cross frame, which is the fastest method. This method is fast, but less accurate.  
Method #2: Use the "Zoom" toolbar. This method is slower, but allows greater accuracy.

### Note:

- After any magnification operation, the Markers may disappear from the current trace window.
- If using method #2 (the "Zoom" toolbar), the "Display Zoom Toolbar" option needs to be turned on from within [Setup].

# 11 Trace Analysis and Event Operation

## 11.10 Cross-Frame to Zoom-in on a Trace

In the trace display area, magnify the traces by clicking and dragging to draw a frame, starting from the upper-left of the display area to the lower-right of the display area.

To zoom-out of the trace, click and drag to draw a frame from the lower-right to the upper-left of the display area.

**Note:** The user may need to repeat the above operation to zoom farther into or farther out of a trace.

### Note:

- Do not cross to the outside of the trace display area, otherwise the operation will abort.
- The trace can only be magnified to a certain degree.
- The trace cannot be contracted to more than a 1:1 ratio.
- The TP-P6 will maintain the level of zoom initiated by the user, even when initiating new traces, until the zoom level is changed by the user.


## 11.11 Using the Zoom Toolbar to Zoom

On the right side of trace window, there is a zoom toolbar vertical ranked. Can use the zoom toolbar to zoom the trace to check the event detail on the trace.


### Note:

- When selecting the magnify button for the first time, the trace window will display the trace in the middle of the built-in screen.
- After the trace has been magnified, in order to move trace window, click anywhere outside the magnified area. The trace window will move to the desired location. The user may also use the arrow keys on the front panel to move the trace.

### 11.11.1 Revert the entire trace view


Click the  icon to revert (zoom-out) of the entire trace.

### 11.11.2 Zoom-in on a trace Horizontally

Click the  icon to zoom-in on the trace horizontally.

# 11 Trace Analysis and Event Operation


## **11.11.3 Zoom-out of a trace Horizontally**

Click the  icon to zoom-out of a trace.

## **11.11.4 Zoom-in on a trace Vertically**

Click the  icon to Zoom-in on a trace vertically.

## **11.11.5 Zoom-out of a trace Vertically**

Click the  icon to Zoom-out of a trace vertically.

## **11.12 Remember the Zoom Status Automatically**

When testing or opening a trace, the level of magnification and position will be remembered temporarily. When testing the same distance again, the magnified status of the window will remain the same until changed by the user.

### **Note:**

- When the user turns off the PRO TP-P6, the zoom settings will not be saved. When the TP-P6 is turned on again, the trace window will display the entire trace threshold.
- When the user changes the wavelength, pulse width and/or time, as long as the distance is not changed, the previously set zoom level will be used.
- When the user changes the distance, the trace window will revert to display the entire trace.

# 11 Trace Analysis and Event Operation

## 11.13 Moving the Magnified Trace Window

After the trace has been magnified, the trace window will only display part of the trace. There are two ways to move the trace window:

1. Using the stylus or mouse to operate in the navigation window.
2. Using the four navigational arrow keys on the front panel.

### To move a magnified trace window from within the navigation window

In the navigation window, the user can see the position of current window on the entire magnified trace. Click anywhere outside of the magnified area of the navigation window and the trace window will move to the new location accordingly.

### Note:

In the navigation window, if the user clicks the grayed-out region, the operation will not initiate.

### Using the arrow navigational keys to move a trace window

While within a magnified trace, use the arrow directional keys on the front panel. The trace window will move accordingly.

- Click the ▲ button to move the trace window upward.
- Click the ▼ button to move the trace window downward.
- Click the ◀ button to move the trace window to the left.
- Click the ▶ button to move the trace window to the right.

### Note:

When displaying an entire trace within the window, the trace window cannot be moved.

# 11 Trace Analysis and Event Operation

## 11.14 Setting the Event Options

The event table lists all of the events within a particular trace. Events can be defined as any point where a change in optical transmission was detected. Events cause loss, which can be caused by a lack of transmission power or quality, faulty splices, defective or dirty connectors or crack/bends in the fiber. If an event exists outside of the defined threshold, it will not be detected or displayed.

Meas. Para.

Events

Markers

Trace Para.

Trace Info.

Source

Type	No.	Location	Ins. Loss	Refl.	Atten.	Cum. Loss	
+	1	0.0000 km	-,---	-40.075 dB	0.000 dB/km	0.000 dB	
+	2	25.3396 km	-,---	-30.315 dB	0.183 dB/km	4.648 dB	

Add

Modify

Delete

Analyze

Fig 11.2 Event Options

**The TP-P6 displays many attributes of a trace:**

- **Type:** Different indicators are used for different event types. For detailed information pertaining to specific types of events, please refer to the appropriate sections of this manual.
- **Number:** Event number (automatically designated by the OTDR application program).
- **Position:** Distance between the OTDR and the event.
- **Insertion Loss:** The loss caused by a loss event, measured in dB (automatically calculated).
- **Reflection Value:** Calculated value for each reflective event.
- **Attenuation:** The attenuation (loss) for each optical fiber length (loss/distance).
- **Accumulation:** The accumulated loss from the span starting point to the end of the span.

### Note:

“Accumulation” is the calculation of all loss within the parameters and does not calculate the events that occur outside of the designated parameters. To determine specific loss occurring within a specific parameter, please refer to the loss results displayed in {Markers}.

# 11 Trace Analysis and Event Operation

## 11.14.1 Display the Event on the trace, and locating the event in the Event Table

At any time, while scrolling through the event table, the user can check the relative info about all events tested on a particular trace. When an event is selected, a **Marker** will be placed at that event.

### Note:

- When the trace is under magnification, certain Markers may not be displayed in the current window.
- It is advisable to first view the entire trace, locate the events, then zoom into specific events to analyze specific details.

## 11.14.2 Add an Event

The user can manually insert events into the event table at any time. For example, when there is a splice point on some given position, but is hidden due to excessive noise, or the splice loss is lower than the minimum set value of a non-reflection detection threshold, then adding an event can be useful. Adding an event manually will add an event number to the insertion point, but will not otherwise alter the trace.

### Note:

When reanalyzing a trace, any manually inserted events will be automatically deleted from the trace.

### To add an event:

1. Press [add] while inside the {Events} tab.

Meas. Para.

Events

Markers

Trace Para.

Trace Info.

Source

Type	No.	Location	Ins. Loss	Refl.	Atten.	Cum. Loss	
+	1	0.0000 km	-,---	-40.075 dB	0.000 dB/km	0.000 dB	
+	2	25.3396 km	-,---	-30.315 dB	0.183 dB/km	4.648 dB	

Add

Modify

Delete

Analyze

Fig 11.3 Adding an Event



# 11 Trace Analysis and Event Operation

2. Fill in the event info in the “Add Event” dialog window.

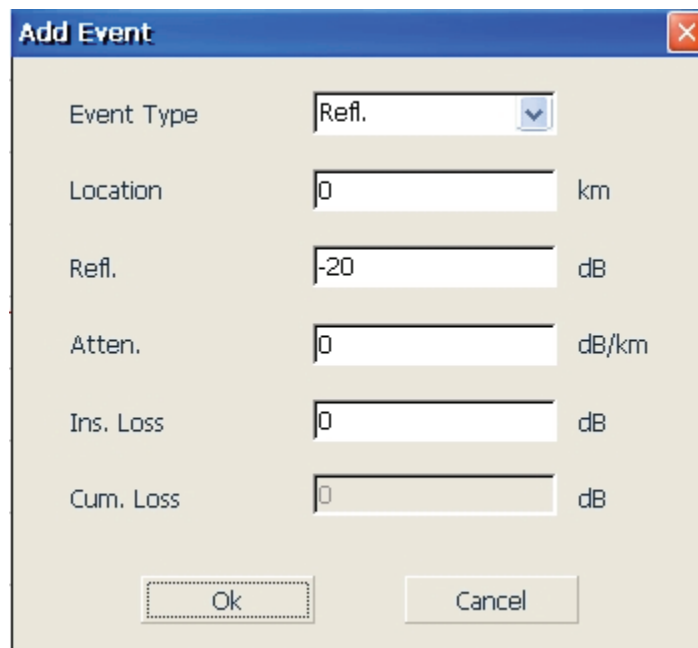
The image shows a software dialog box titled "Add Event" with a standard Windows-style title bar (blue with a close button). The dialog has a light beige background. It contains six input fields arranged vertically, each with a label to its left and a unit to its right. The first field is a dropdown menu labeled "Event Type" with "Refl." selected. The second field is a text box labeled "Location" with "0" entered and "km" as the unit. The third field is a text box labeled "Refl." with "-20" entered and "dB" as the unit. The fourth field is a text box labeled "Atten." with "0" entered and "dB/km" as the unit. The fifth field is a text box labeled "Ins. Loss" with "0" entered and "dB" as the unit. The sixth field is a text box labeled "Cum. Loss" with "0" entered and "dB" as the unit. At the bottom of the dialog are two buttons: "Ok" and "Cancel".

Fig 11.4 Add Event Dialog Window

3. Press [Ok] to save and return to the main window after editing is complete. The event will appear in the event list. Select [Cancel] to exit without saving..

## Note:

You can add either a reflection event or a non-reflection event.

### **11.14.3 Modifying an Event**

The user can modify an event in the event table manually. For example, if you find a faulty splice, and repair the affected area of fiber, you can then choose to alter the event corresponding to that splice point, which will show a more accurate trace record. Alternatively, you could make all of the repairs necessary and then reanalyze the fiber span.

## Note:

- Adding an event manually will not alter the calculated trace data from the original trace.
- When reanalyze the trace, events will be re-marked and modified events (if not repaired or altered) will revert to their original value

# 11 Trace Analysis and Event Operation

## How to Modify an event:

1. Press [Modify] after selecting an event in the events tab.

Meas. Para.

Events

Markers

Trace Para.

Trace Info.

Source

Type	No.	Location	Ins. Loss	Refl.	Atten.	Cum. Loss	
I-	1	0.0000 km	-,---	-40.075 dB	0.000 dB/km	0.000 dB	
→	2	25.3396 km	-,---	-30.315 dB	0.183 dB/km	4.648 dB	

Add

Modify

Delete

Analyze

2. From here the user can alter the event info, replacing any existing data.

**Modify Event**

Event Type

Start

Location

km

Refl.

-40.075

dB

Atten.

dB/km

Ins. Loss

dB

Cum. Loss

dB

Ok

Cancel

3. Press [Ok] to save and automatically return to the main window after editing is complete. The event will now appear in the event list. Press [Cancel] to quit without saving.

# 11 Trace Analysis and Event Operation

## 11.14.4 Deleting an Event

Except for the following events, almost all of the events can be deleted from event table.

- Analysis complete
- Starting point of the span
- End point of the span

### Note:

Once deleted, there is no way to recover deleted trace data. The trace must be reanalyzed to recover the trace data, which may differ (slightly) from the original trace.

### How to Delete an Event

1. Select the event to be deleted.
2. Click {Delete}
3. When prompted, click "Yes" to delete the selected event. Select "No" to return to the main interface without deleting.

Meas. Para.

Events

Markers

Trace Para.

Trace Info.

Source

Type	No.	Location	Ins. Loss	Refl.	Atten.	Cum. Loss	
+	1	0.0000 km	-,---	-40.075 dB	0.000 dB/km	0.000 dB	
-	2	25.3396 km	-,---	-30.315 dB	0.183 dB/km	4.648 dB	

Add

Modify

Delete

Analyze

# 11 Trace Analysis and Event Operation

## 11.15 Analysis Detecting Threshold Configuration


In order to optimize the event detection, the user can set the testing thresholds.


- Change a non reflection threshold (Splice Loss Threshold): It can display or hide small non-reflection event
- Change a Reflection Threshold: On the low end it can hide the false reflection events caused by noise, or convert the harmless reflection event into a loss event. On the high side, it can detect events which may cause damage to network and other optical fiber equipment, due to excessively high light levels.
- Change the finish threshold (optical fiber End Threshold): It can analyze an important loss event (like a break point) and halt event analysis following that event.

### Note:

User-set thresholds apply to “Auto” mode, as well as “Manual” mode.

## 11.16 Set Analysis Detecting Threshold

1. Select the  icon in the button area (which is in the lower-right area) to enter setting interface.
2. Set these parameters in the parameters analysis window. In the relative edit frame, enter the new value, or press [Default] to revert to the default value.

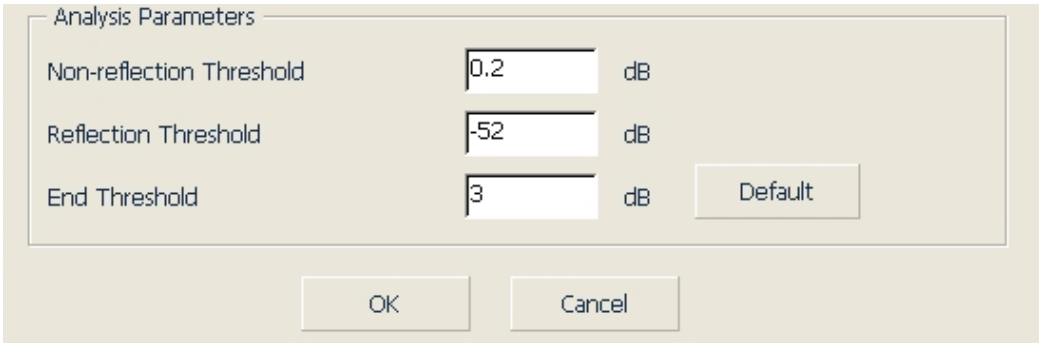

The image shows a dialog box titled "Analysis Parameters". It contains three rows of settings, each with a label, a text input field, and a unit "dB". The first row is "Non-reflection Threshold" with a value of "0.2". The second row is "Reflection Threshold" with a value of "-52". The third row is "End Threshold" with a value of "3". To the right of the "End Threshold" row is a button labeled "Default". At the bottom of the dialog box are two buttons: "OK" and "Cancel".

Parameter	Value	Unit
Non-reflection Threshold	0.2	dB
Reflection Threshold	-52	dB
End Threshold	3	dB

Fig 11.8 Parameters Analysis Edit Frame

3. Press [Ok] to save the new settings and return to the main interface. Press [Cancel] to quit without saving.

### Note:

Threshold settings will be applied to the subsequent traces, and will not alter data acquired from previous traces..

# 11 Trace Analysis and Event Operation

## 11.17 Reanalyzing a Trace

The user can reanalyze a trace at any time. Reanalyzing a trace will accomplish the following:

- Create a new event table for a trace.
- Reanalyze a trace utilizing new-introduced features offered by updated software.
- Update an existing event table -if the data has been modified or repairs have been made.

### To reanalyze a trace:

1. In the [Event] options, press [Analysis]. The TP-P6 will then initiate a new trace.
2. After the analysis is complete, the new results will be displayed in the event table.

### Note:

- If the thresholds used are too restrictive, meaning that few or no events were detected, please alter the threshold settings and initiate a new test using wider parameters.

## 11.18 Analyze the Optical Fiber in a Specific Optical Fiber Span

Because a PON optical fiber span has a splitter (multiple spans), the user needs to set the proper finish threshold (optical fiber End Detecting Threshold) to analyze the end event, which can be affected by the splitter.

The thresholds must be set before initiating a test, or the results may be innaccurate or inconsistent.

# 11 Trace and Event Analysis Settings

## 11.19 Set Trace Display Parameters

The user can modify or alter trace display options before or after a test or trace is opened.

- **Grid line:** Select or deselect this to display or hide the grid lines. By default, the TP-P6 is set to display the grid.
- **Navigation Window:** The user can choose to either show or hide the navigation window which, if shown, appears in the upper-right of the trace screen.
- **Length Unit:** Either before or after a trace is performed, the user can change the unit of measurement used throughout the interface.
- **Multiple Trace:** If turned on, the TP-P6 will simultaneously display multiple traces onscreen.
- **Zoom Toolbar:** The factory default is set to display the “Zoom” toolbar. If the user desires to maximize the screen display area, this toolbar can be turned off.


### Note:

When the user first enters the OTDR interface, the help info for simple operations are displayed onscreen in the trace area, obstructing the navigation window and grid lines. Only after a test, or after a trace is opened, do the grid lines and navigation window become visible again.

### To set the trace display parameter



1. Select **Setup** in the button bar, on the lower-right of the OTDR menu.
2. In the options of test display area, select and modify the display options
3. Press [application] and make change become effective, then quit the setting dialog box. or press [cancel] to quit the setting dialog box without setting save.

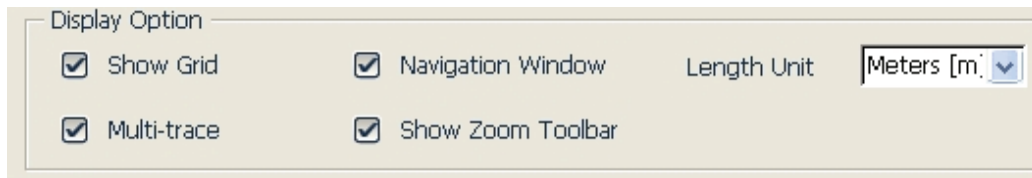

### Note:

To hide or display the zoom toolbar must turn off all the trace opened. Otherwise the setting won't go into effect.

# 11 Trace and Event Analysis Settings

## 11.20 Set the length unit

In the OTDR parameters setting dialog box, select the length unit in the test display area options. The unit can be set to display in meters, feet or miles.

### Note:

- The default length unit is the meter, displayed as “m”.
- Certain values, such as pulse width, wavelength, etc will not change, regardless of the distance. For example, Pulse is always measured in seconds, while wavelength is always measured in nm.
- If “m” is used as the length unit, the system will display km in some places.
- When selecting “ft” as the unit of measurement, the system will display kft in some instances (k=x1,000).
- When selecting “mi” as the unit of measurement, the system will display kmi in some places (k=x1,000).

## 11.21 Display or Switch the Trace

In the OTDR test application program, when opening multiple traces, there are two ways to switch the displayed trace

1. To display or hide the trace, click the **file name** tab on the upper-left.
2. To close the trace, click the [close trace] on the interface, in the upper-right of the window.

## 11.22 Check Current Trace Parameters

To check the current trace information on the {Trace Info} tab, simply click the tab.

Meas. Para.	Events	Markers	Trace Para.	Trace Info.	Source
Parameters		Value			
File Name		Test_1550_25.sor	IOR		
Date		2010-03-08 13:45:54	Scat. Coef.		
Wavelength		1550 nm	NRefl. Threshold		
Pulse Width		1000 ns	Refl. Threshold		
Avg. Time		60 s	End Threshold		
Range		40.000 km			

Fig 11.10 Check the Trace Parameters

# 11 Trace and Event Analysis Settings

The content that the TP-P6 can display is as follows:

- **File Name:** The name of current trace.
- **Date:** Date and time of test.
- **Wavelength:** The laser wavelength used for testing.
- **Pulse Width:** The laser pulse width used for sampling.
- **Averaging Time:** Continuous sampling time.
- **Range:** Distance used for testing.
- **Span Length:** The length of optical fiber span, as calculated after test completion.
- **Span Loss:** The total loss, from the span starting point to the span end point.
- **Span Attenuation:** Average loss of the total span, indicated as a function of distance.
- **Event Quantity:** Total number of events detected from the current trace analysis, which is accordance with the test parameters.

The content displayed on the right of the display window is as follows:

- **IOR:** Indicate the trace IOR (also called group coefficient). If modifying this parameter, it will adjust the trace distance automatically
- **Back Scatter:** Rayleigh Back Scatter of the displayed trace.
- **Non-Reflection Threshold:** Check the current setting of small Non-Reflection Events during the trace analysis.
- **Reflection Threshold:** Check the current setting of small Reflection Events during the trace analysis.
- **End Threshold:** Check the current setting of the limit of detected events (will affect the transmission performance during the trace analysis).

## Note:

Trace parameter options only display the active, selected trace, even when multiple traces are opened. If you wish to view the information pertaining to a particular trace, you will need to click on that trace. The active, selected trace will always be indicated in **red**.



# 12 Manual Trace Analysis

A user can use **Markers** and **Zoom** tools to measure **Splice Loss**, **Attenuation** and **Reflection**, or use Markers to locate **Event Position** and **Relative Power Level**.

## 12.1 To Use Markers

Click the {Markers} tab in the OTDR main interface to activate Markers.

## 12.2 Event Location and Loss Information

The OTDR application automatically calculates the event location and displays the location in the Events list. The user can manually check the event location and distance between events. Loss information can also be displayed. The X-axis represents distance and Y-axis represents Relative Power.

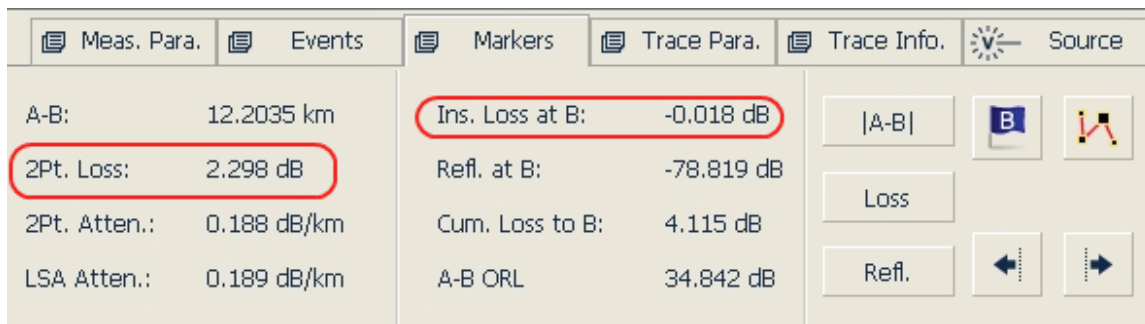


Fig 12.1 Event Location and Loss Information

To acquire the event location and loss information:

1. Click the {Markers} tab in OTDR main interface.
2. Place Marker A or B to at the beginning of the event, the Marker tab will display the distance.
3. Fig 12.1 shows the insertion loss of current Marker and A-B loss.

# 12 Manual Trace Analysis

## 12.3 Measuring Insertion Loss (2-Point and 5-Point method)

**Insertion Loss** (unit: dB) is calculated by measuring the signal level of Rayleigh Back Scatter (RBS) and the magnitude of reduction. Insertion loss can be created by reflection and non-reflection events.

The system calculates (in real-time) the loss between Markers A and B, and also calculates the insertion loss at Marker A or B. Insertion loss is calculated in a 5-Point method.

### 2-Point Method (A-B Loss):

Insertion loss is calculated as shown in Fig. 12.2.

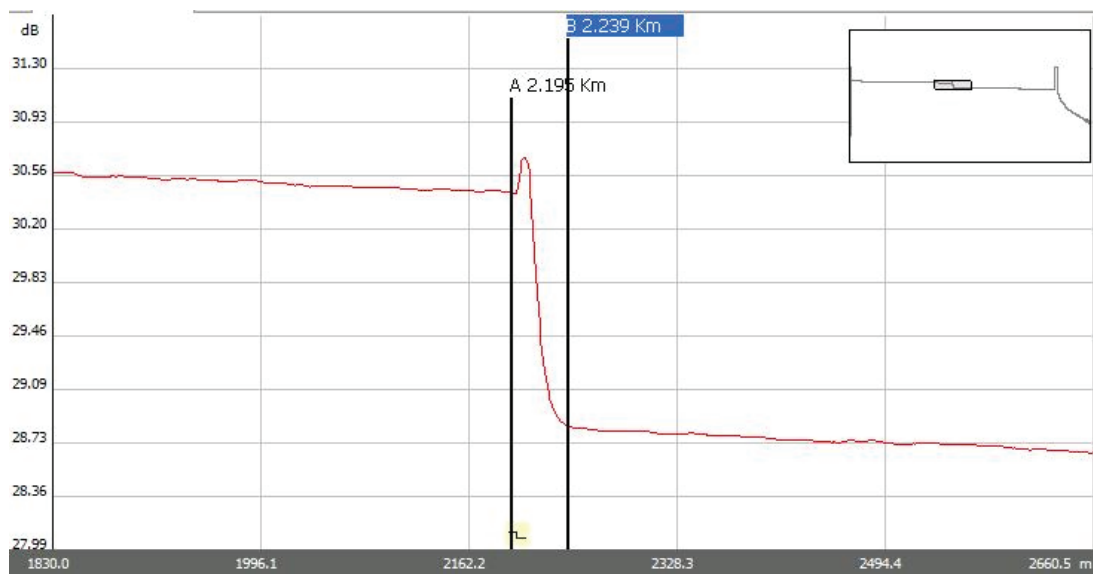


Fig 12.2 2-Point Loss

The 2-Point method is suitable for measuring splice loss, but not applicable to measuring reflection events.

### Note:

- "A-B Loss" is for quick loss measurement of a specific segment of the fiber, marked between Marker A and B.
- "A-B Loss" is not applicable to measuring "Reflection" events.


# 12 Manual Trace Analysis

## 5-Point Method to Measure Event Loss:

Event loss can also be measured by a 5-Point method. When the [Loss] button in “Markers” Tab is not pressed, the marking points used by 5-Point method will not be displayed. The system uses the 5-Point method by default.

When applying the 5-Point Method manually, the Marker and its related 4 marking points divide the trace around the event into 2 areas: the area left of the active Marker and the area the the right of the Marker. The 2 marking points on the left, and the 2 on the right, both form a straight line and move the two lines close to the event center. The calculated power difference between the two lines is the Event Insertion Loss.

This method also applies to the measurement of point A or B’s Insertion Loss.

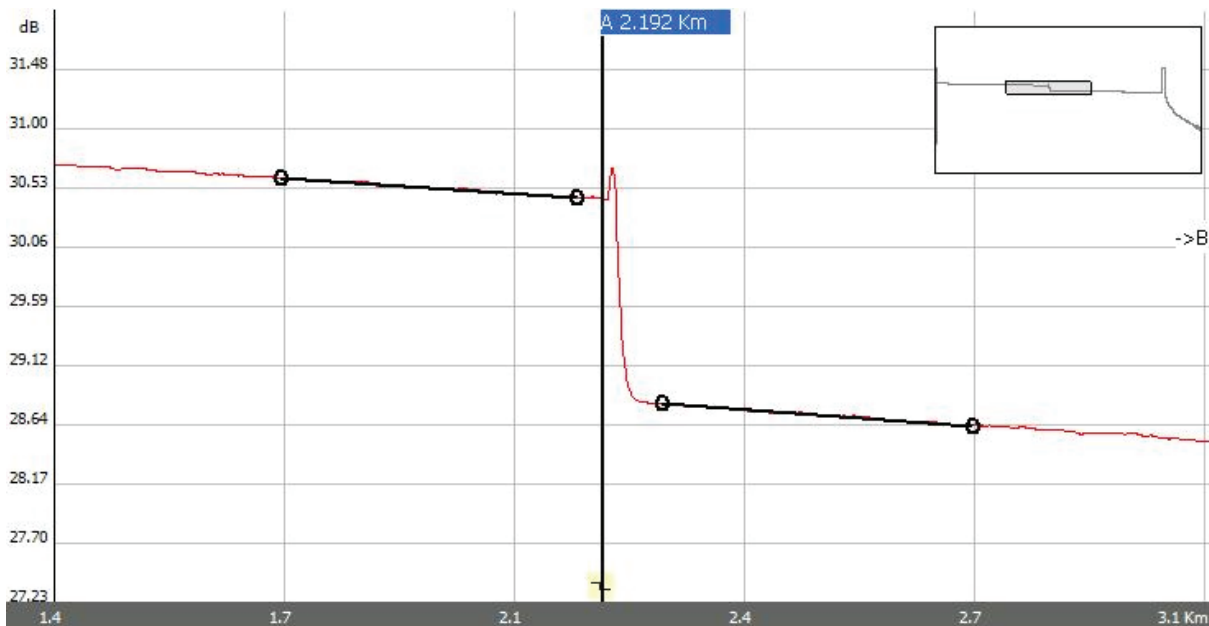

When the [Loss] button is pressed, the PRO TP-P6 will show the marking points to measure the event loss. When Marker A is selected, the screen will display the 4 marking points related to Marker A. When Marker B is selected, the screen will display the 4 marking points related to Marker B. The Markers and marking points can be moved separately.

# 12 Manual Trace Analysis

## Using the 5-Point Method:

1. In the main interface of the PRO TP-P6 OTDR module, click the “Markers” tab.
2. Press the [Loss] button. Marker A, Marker B and their related marking points will be displayed on the trace.
3. Zoom into the trace to view the event clearly. Move **Marker A** to the end of the linear section of the trace - before the event.
4. Move the **first** marking point to the beginning of the linear part of the trace before the event.
5. Move the **second** marking point to the end of the linear part of the trace before the event.
6. Move the **third** marking point to the beginning of the linear part of the trace after the event.
7. Move the **fourth** marking point to the end of the linear part of the trace after the event.

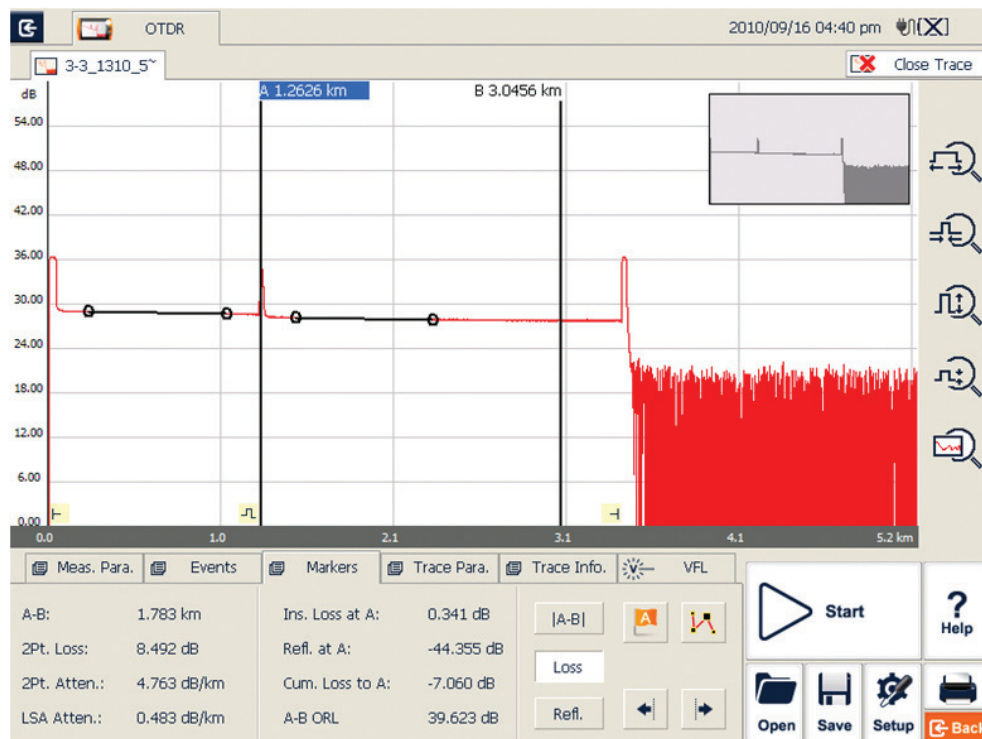


Fig. 12.4 Measuring Insertion Loss Using 5-Point Method

## Note:

- The marking points on the left of the active Marker cannot be moved the right - and vice versa.
- The loss shown in the Event List is measured by the 5-Point method.

# 12 Manual Trace Analysis

## 12.4 Measure Attenuation (2-Point and LSA method)

2-Point method measures the attenuation between Marker A and B calculated by all the loss over the distance between Marker A and B (Unit: dB/Km).

The LSA (Least-Squares Approximation) method uses linear regressions that is applied to the backscatter before and after an event (Between Marker A and B) to estimate the attenuation in the backscatter resulting from the event's loss.

The LSA method only measures the amplitude (decibel) change between the crossing points of the trace based on Marker A and B.

Compared to the 2-Point method, the LSA method is more accurate because it is less sensitive to trace noise and more suitable for measuring splice attenuation. However, the LSA method should not be applied to measuring attenuation when there are reflection events between Markers A and B.

### Measuring attenuation:

1. Click {Markers} tab in OTDR main interface to show Marker A and B.
2. Place Markers A and B at different points on the trace.
3. Zoom-in on the trace to adjust the Marker position when necessary.
4. Check 2Pt. Atten. (2-Point Attenuation) and LSA Atten. (LSA Attenuation) values, as shown in Fig. 12.5.





Meas. Para.	Events	Markers	Trace Para.	Trace Info.	Source
A-B:	12.2035 km	Ins. Loss at B:	-0.018 dB	A-B	
2Pt. Loss:	2.298 dB	Refl. at B:	-78.819 dB	Loss	
2Pt. Atten.:	0.188 dB/km	Cum. Loss to B:	4.115 dB	Refl.	
LSA Atten.:	0.189 dB/km	A-B ORL	34.842 dB		

Fig. 12.5 Viewing Attenuation

### Note:

There should not be any event between Marker A and B when measuring attenuation with the 2-Point method.

# 12 Manual Trace Analysis

## 12.5 Measuring Reflectance


Reflectance is the ratio of reflected power ( $P_r$ ) to incident power ( $P_i$ ) of an event (such as a connector).

Reflectance =  $10 \log (P_r/P_i)$ .

1. Click the {Markers} tab in the OTDR main interface to show Marker A and B.
2. Click the [Refl.] button to show the Marker points.
3. Before measurement, zoom-in on the trace and place Marker A to one end of the linear part of the trace before the event.
4. Move the first marking point to the beginning of the linear part of the trace before the event and Marker A.
5. Move the second marking point to the end of the linear part of the trace before the event and Marker A.
6. Place the marking point behind Marker A to the peak of the reflection event to be measured.
7. View the reflectance.

### Note:

The above process is applicable to measuring all reflection events' reflectance even they are very close to each other.

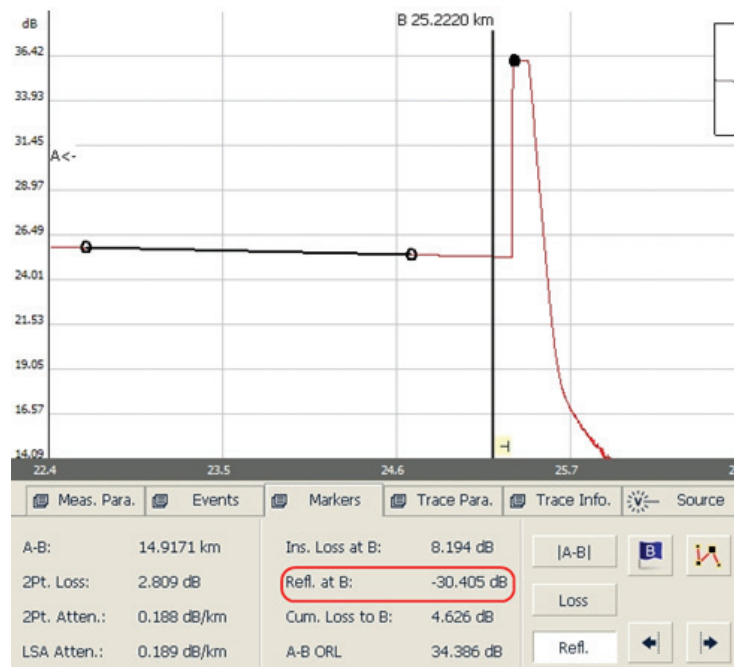

# 13 Trace File Management

## Note:

1. For non-reflection events, reflectance will show as “-----”.
2. The user can save, open, rename and delete trace file after acquisition.
3. The user can save and open trace file in OTDR main interface.
4. The user can rename, copy, move and delete file in File Explorer.

## 13.1 To Save a Trace in Different Formats


In OTDR main interface, user can choose trace saving format as Bellcore (.sor) or JPEG (.jpg).

## 13.2 To Copy, Move, Rename and Delete a Trace

There are two ways to copy, move, rename and delete trace.

### Way 1: Through File Explorer:

A. In PRO TP-P6 main interface, click {Program} tab and click [File Explorer] icon as shown in Fig 13.1:

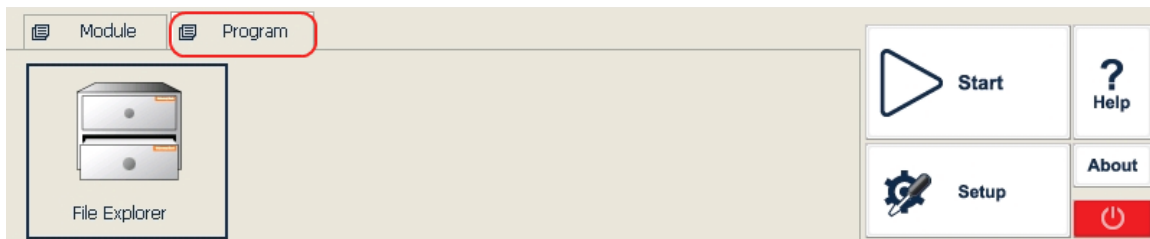

B. Click [ ] button or press button on front panel to enter File Explorer.

C. Click “SDMMC\_Disk” icon to enter internal memory space.

D. Copy, move, rename and delete trace.

E. After operation, click [ ] button to return to main interface.

## Note:

- In File Explorer, the file and directory operation is similar to Windows 98/XP system.
- User can move, rename and delete files saved in “SDMMC\_Disk” but the disk itself cannot be moved, renamed or deleted.
- For more information, please refer to the Help file on PRO TP-P6.


**Way 2:** User can connect PRO TP-P6 to PC, PRO TP-P6 will be recognized as a mobile device. User can copy, move, rename and delete files in PC’s Windows System.

# 13 Trace File Management

## 13.3 Checking the Available Disk Space

The user can check disk utilization (used space and free space) in the File Explorer:

1. Enter File Explorer from the PRO TP-P6 main interface.
2. Click the “SDMMC\_Disk” icon and select [File] <Properties> or click and hold the “SDMMC\_Disk” icon, select <Properties> from pop-up menu.
3. The “SDMMC\_Disk” space utilization status is shown below:

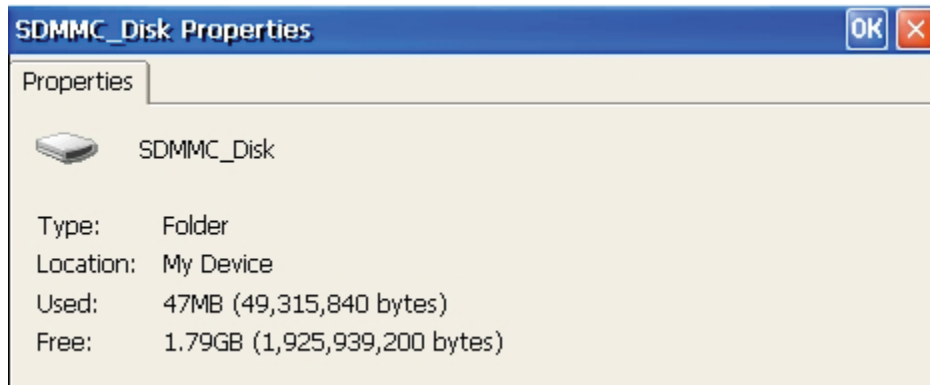

4. Click “OK” to exit the disk properties.

### Note:

It is suggested that the user check disk utilization periodically, transferring or backing up files to avoid running out of disk space when the PRO TP-P6 is in use.



# 14 Print OTDR Report

The User can manage a saved trace file directly on the PRO TP-P6, as well as print a report. For reference and report printing, it is necessary to manage and update the trace information.

## 14.1 Trace Information

After trace acquisition, the user can add or update tested fiber information ,which includes: Cable ID, Fiber ID, Fiber Type, Start Location, End Location and Operator.

## 14.2 Check and Edit Trace Information


The user can check and edit the trace information from the {Trace Info.} interface. When a newly-tested trace is saved, the trace is saved with the information listed in the “Trace Information” section (14.1).

The user can also edit the saved trace information.

- After editing the trace information of a saved trace, the updated trace file name will show a star sign (“\*”) to indicate that the file has been changed. If the user attempts to close the editing window without saving, the system will prompt the user to save the file.
- Updating of trace information is only effective with the current active trace in “Multiple-Trace” display mode.
- The editing of trace information does not affect either the measurement parameters or the end results.

### Edit and save trace information:

1. Click the {Trace Info.} tab in OTDR main interface.

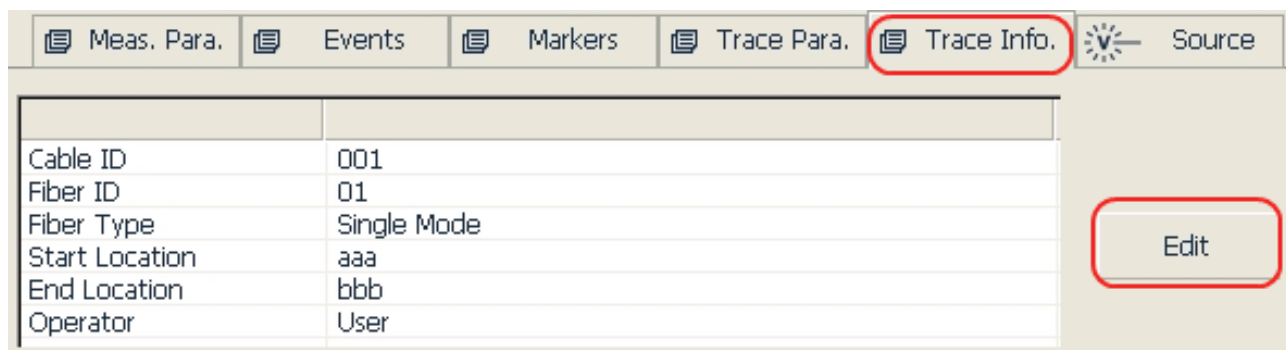


Cable ID	001
Fiber ID	01
Fiber Type	Single Mode
Start Location	aaa
End Location	bbb
Operator	User

Edit

# 14 Print OTDR Report

2. Press the [Edit] button and the trace window will pop up.
3. You may alter any of the information displayed:

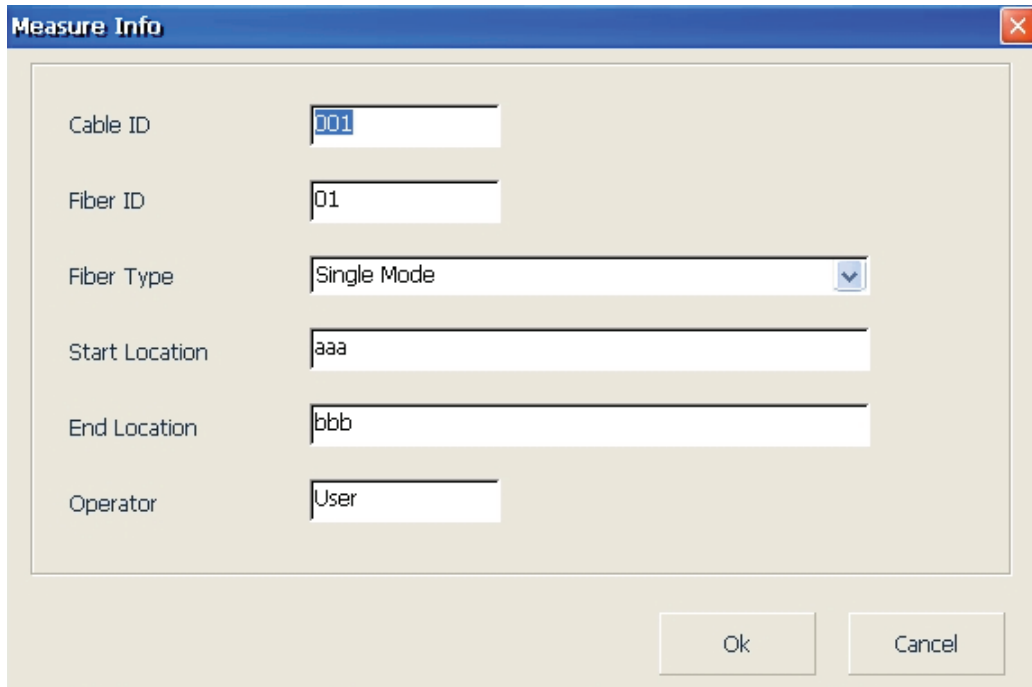

The screenshot shows a 'Measure Info' dialog box with the following fields and values:

Field	Value
Cable ID	001
Fiber ID	01
Fiber Type	Single Mode
Start Location	aaa
End Location	bbb
Operator	User

Fig 14.2 Edit Trace Information

4. After editing, press [Ok] to save and return to main interface, or click [Cancel] to exit without saving the changes.
5. Click the [Save] button in the OTDR main interface to save the trace again. The updated information will be saved with the trace file.

## Note:

- An edited and saved trace file can be used as a template for later reference.
- The user can also use the TP-P6 Data Management software to edit and save trace information.

## 14.3 Print OTDR Report

The PRO TP-P6 supports direct printing, via USB.

The OTDR report includes: Trace Information, Measurement Parameters, Markers information, Event List, etc.

Specific contents to be printed can be specified in Print Options.

# 14 Print OTDR Report

## Print OTDR report:

1. Connect the USB printer to the PRO TP-P6

Note: Before attempting to print for the first time, please configure the printer through the “Printer Configuration” interface.

2. Click the  icon in the OTDR main interface and printing dialog window will pop up.

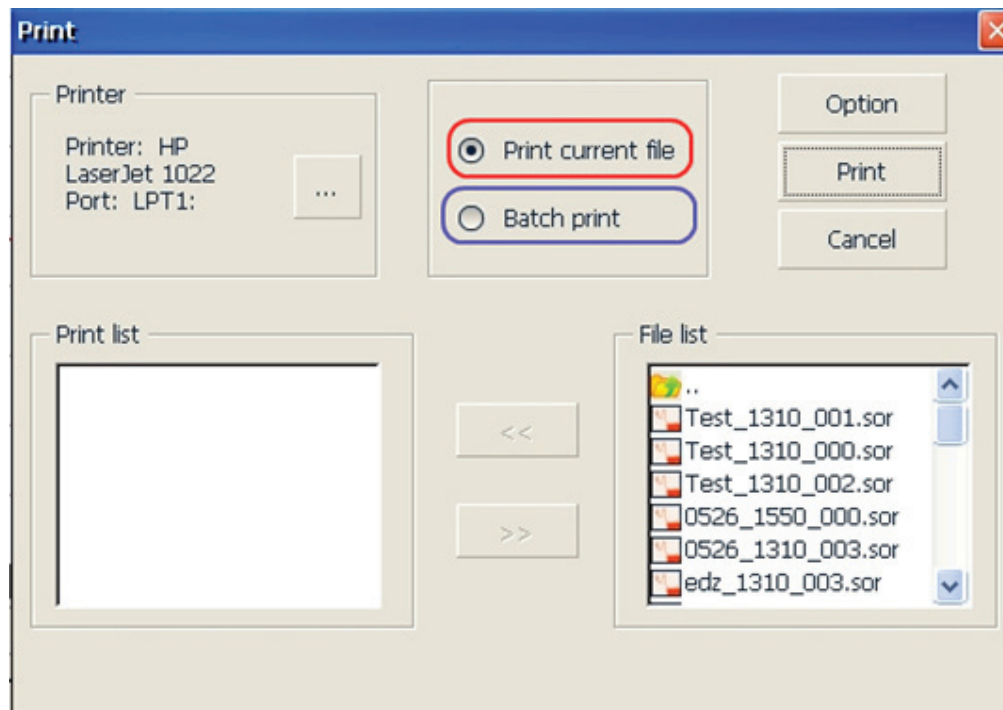


Fig 14.3 Printing dialog window

3. Choose the trace (or multiple traces) to be printed:
  - A. To print the current file, please choose the “Print current file” option and only one trace will be printed.
  - B. To print unopened traces saved in PRO TP-P6, please check “Batch print” option, which will allow batch printing of up to eight (x8) traces.

# 14 Print OTDR Report

## 4. Print Option:

The user can customized the OTDR report by clicking the [Option] icon, on the printing dialog window, to specify which contents to be printed.

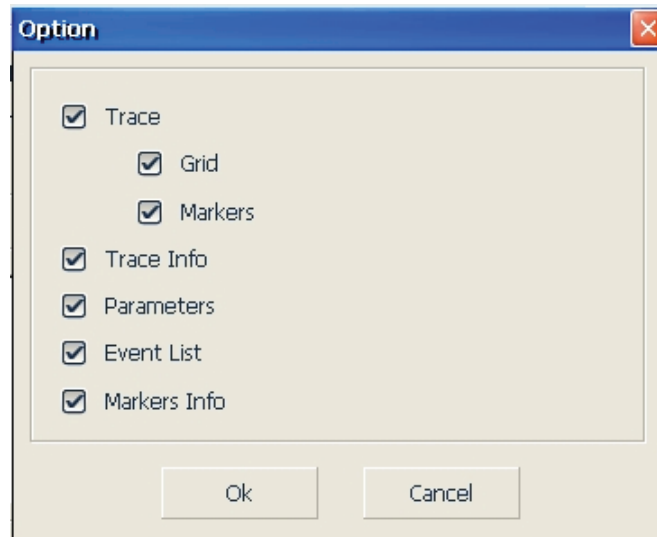


Fig 14.4 Printing Options

## 5. Press the [Print] button to start printing.

During printing, the system will display the status: "Printing... Pease wait", as shown in Fig 14.5.

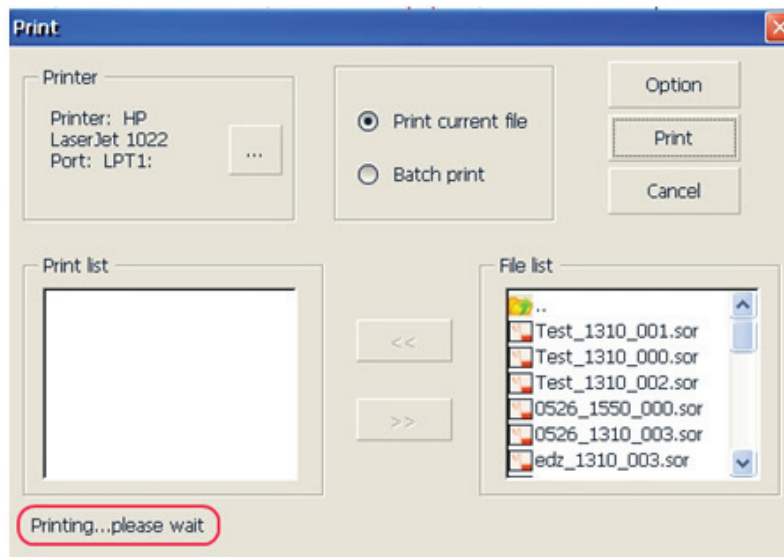


Fig 14.5 Printing

## 6. After printing is complete, the TP-P6 will automatically return to the main interface.

# 15 VFL Application

The built-in VFL of the OTDR module can shoot a red laser into the fiber under test. The red laser will be visible at a marco bend, point of breakage and/or bare fiber end. The maximum detection range for the PRO TP-P6 VFL is over 5Km, making it a very useful tool for fiber identification and detection, as well as highlighting breaks, tight bends, splices and/or defective connectors in optical fiber spans.




## Note:

The VFL is a perfect complementary tool to be used in conjunction with the OTDR, especially useful for its ability to make visible the problems occurring in the area close to the OTDR, such as problems that exist in the “Dead Zone.”

## Note:

The VFL is only available with an OTDR module that has been ordered with the VFL option.

### Fault locating with the VFL:

1. Clean the connector properly.
2. Connect the fiber to the VFL port.
3. Click the (Source)  icon in the OTDR main interface.
4. Check the “CW” (Constant Wave) option to emit a laser continuously, or check “Flash” to emit a modulated laser at 1Hz.
5. Press the [VFL On] button to start the VFL. The  icon will then turn orange.
6. While the VFL is operational, press [VFL Off] to turn off the VFL. The  icon color will turn from orange back to grey.

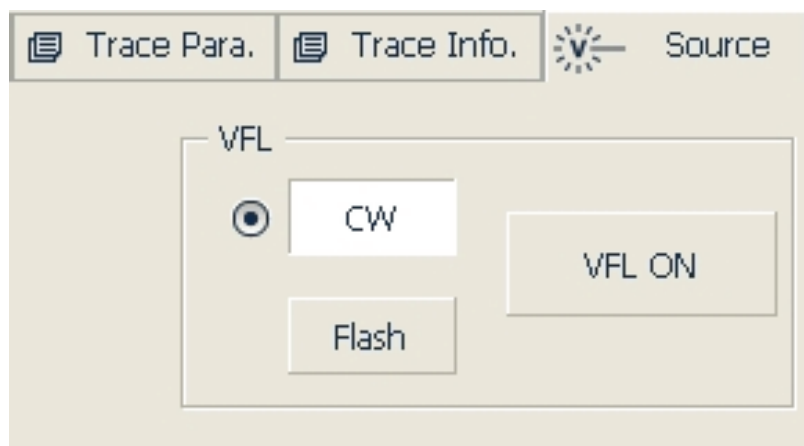


Fig 15.1 VFL Operation

# 16 Using the MPN Module

## 16.1 Main Features of the MPN Module

- Simultaneous display of “Triple-Play” PON signals at 1310, 1490 and 1550nm wavelengths.
- Burst mode 1310nm upstream signal detection & measurement.
- Dual-port, pass-through design.
- Stabilized Laser Source at 1310, 1490, 1550 and 1625nm wavelengths.
- Optical Power Meter at 850, 1300, 1310, 1490, 1550 and 1625nm calibrated wavelengths.


## Warning!!


**Laser Radiation:** To avoid serious eye injury, never look directly into the optical outputs of fiber optic network equipment, test equipment, patch cords, or test jumpers.

- Always avoid looking directly into the optic output port, when the instrument is operational.
- Always replace protective dust caps on the detector port when the instrument is not being used.
- Always avoid looking directly at the unconnected end of optical fiber in testing and make the unconnected end pointing at a non-reflective object, if possible.

## 16.2 MPN Module Interface

When the power is on, it will show the main menu automatically. Only the modules that are connected will be represented onscreen. As you add modules, thumbnail images of that equipment will automatically be recognized and added to the bottom of the main interface.

In the main menu, select the module you wish to use. Once selected, press the  **Start** button to enter that particular module's interface, as shown below:

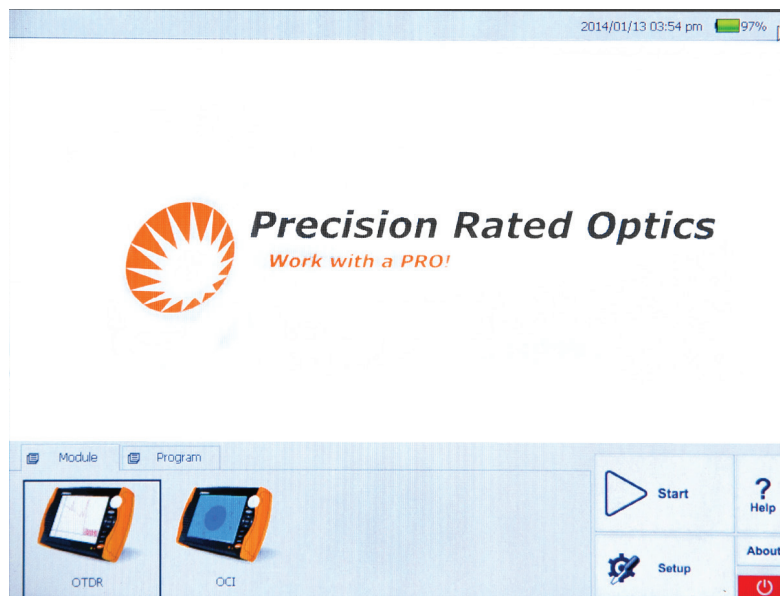

# 16 Using the MPN Module

## 16.3 PON Power Meter of MPN Module

Click the MPN Module icon to enter the interface, as shown in Fig 16.2

At any time, the user can click the different modules (shown on the top-left of the screen) to shift between different module interfaces. For example, you can instantly switch between “PPM (PON Power Meter)”, “SLS (Stabilized Laser Source)”, “OPM (Optical Power Meter)” and “LTS (Loss Test).”

### Note:

Switching between different module interfaces is only possible when there are two or more modules.

Click the  **Start** button or Press the  (Start/Stop) button on PRO TP-P6 front panel to start the measurement. Click  button or Re-Press  (Start / Stop) button on the PRO TP-P6 front panel to stop the measurement.

### Note:

The selected function (module) will turn **red**.

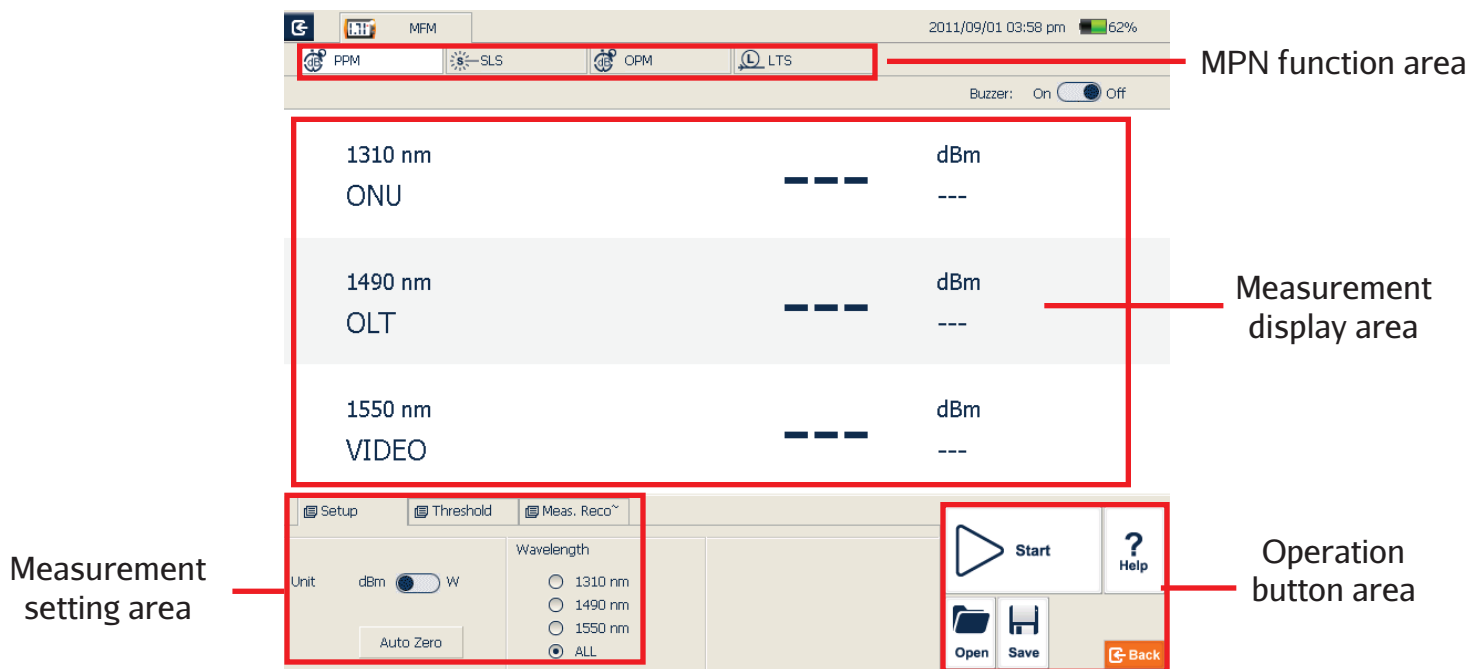


Fig 16.2 PON Power Meter Interface of Multiple-func Module

Under “PPM” there are three setting interfaces: “General Setup”, “Threshold Setting,” and “Measurement Record”.

# 16 Using the MPN Module

The “General Setup” interface is shown in Fig 16.2.

**“Buzzer”:** Switch on or off to open/close the alarm buzzer function. With this feature turned on, when the TP-P6 detects a power value beyond the normal range, a buzzer will automatically sound.

**“Unit”:** Switch to select between “W” or “dBm”.

**“Auto Zero”:** This function provides an easy method of auto zeroing the Power Meter, which can be used to rectify the TP-P6 power value under non-luminous states, for day-to-day testing purposes.

## Warning!!

Always replace the protective cap on the Optical Power Testing output, and ensure that the tie-in is completely covering the port, making it impossible for laser light to escape.

**“Wavelength”:** Select this to display one wavelength individually or three wavelengths together.

Create or delete the Threshold value in the “Threshold” interface, as shown in Fig 16.3.

Click “setup”=> “Current Thre. Set” to select a certain threshold.

The user may also select a default threshold set, as shown on the left-side of the display. When a threshold is selected, information pertaining to that specific threshold will be displayed on the right-side of the display.

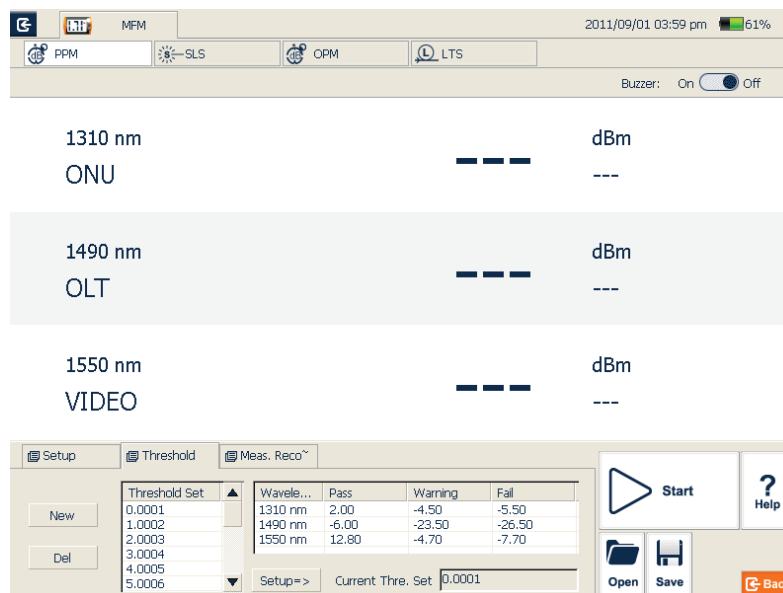


Fig 16.3 PON Power Meter - Threshold Interface



# 16 Using the MPN Module

Double-click any Threshold Set to modify the settings, as shown in Fig 16.4. Click “OK” to save the new settings.

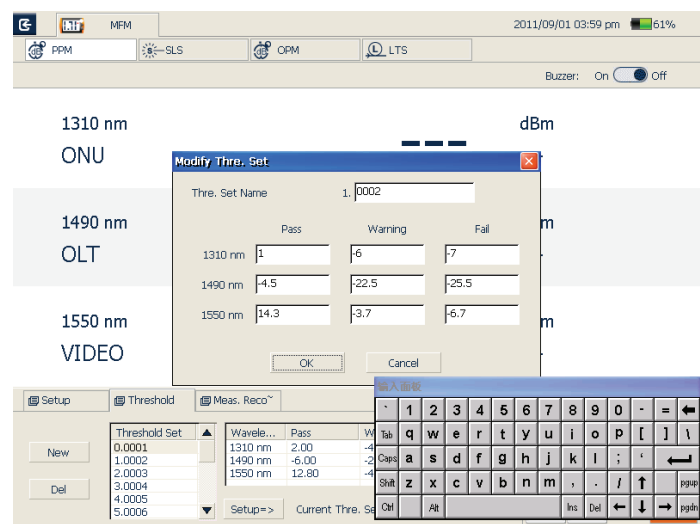


Fig16.4 PON Power Meter- Modify Threshold Set

The “Measurement Record” interface is shown as Fig 16.5.

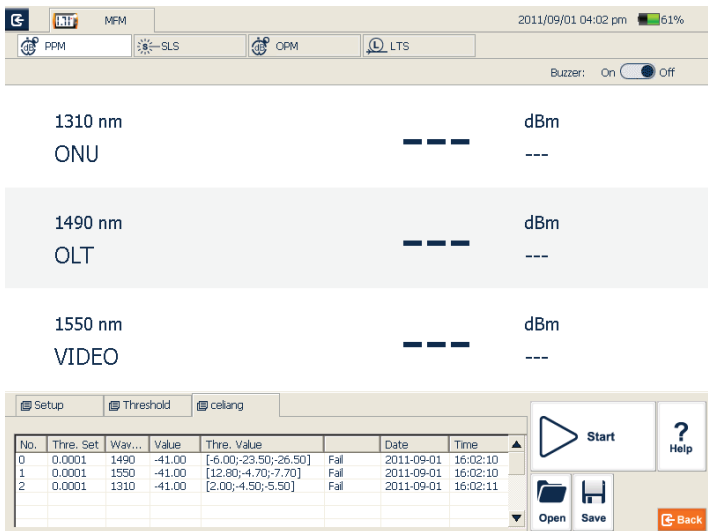


Fig 16.5 PON Power Meter - Measurement Record

The name will be changed according to the user’s input. Click the “Open” icon to find and select any particular named measurement record file. The user may then input a new file name in the “Name” field, as shown in Fig 16.6.

# 16 Using the MPN Module

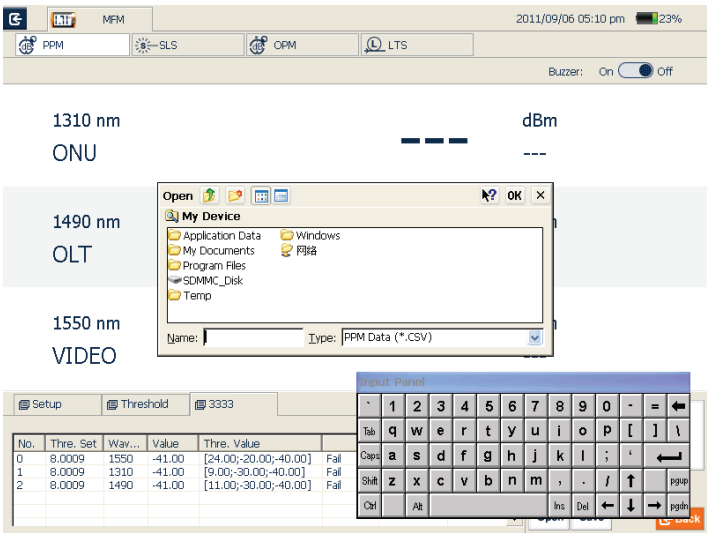



Fig 16.6 PON Power Meter-Open

Click “Save” to save the records.

## 16.4 Stabilized Laser Source of MPN Module

Under “SLS” there are two setting interfaces: “General Setup” and “Reference Setting.”

The “General Setup” interface is shown in Fig 16.7

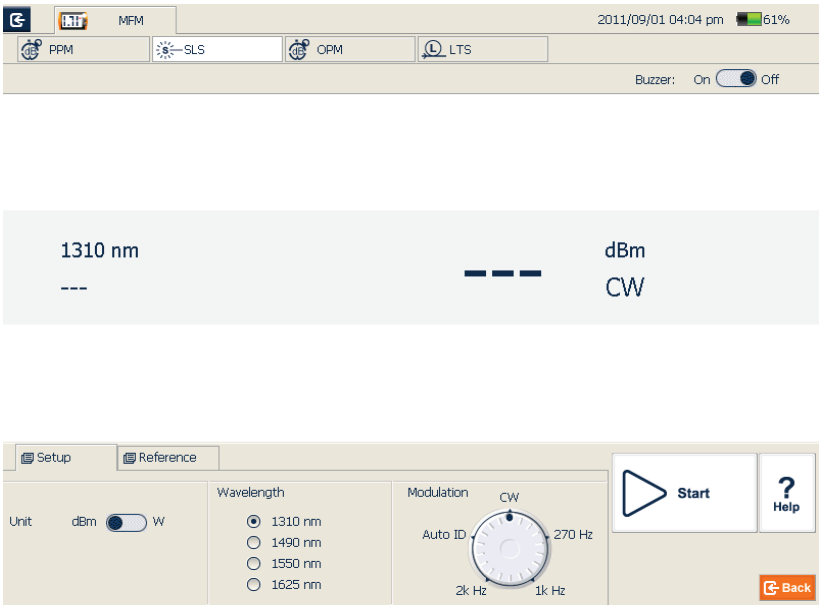

# 16 Using the MPN Module







Fig16.7 Stabilized Laser Source - Setup Interface

**“Unit”:** Shift between dBm and W.

**“Wavelength”:** Support 1310, 1490, 1550 and 1625nm wavelengths.

**“Modulation”:** Select the different modes at 270Hz, 1KHz, 2KHz, Auto ID.

After the setup, click the  button or Press the  (Start/Stop) button on PRO TP-P6 front panel to start the measurement. Click the  button or Re-Press the  (Start/Stop) button on PRO TP-P6 front panel to stop the measurement.

## Note:

The function icon turns red while switching on this function module.

The “Reference Setting” interface is shown as Fig 16.8

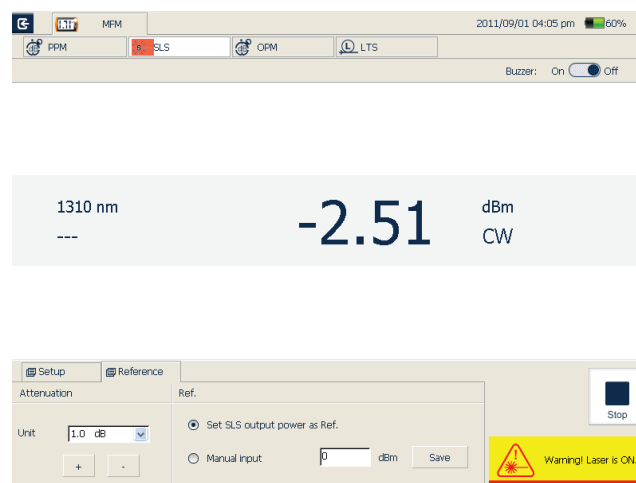


Fig 16.8 Stabilized Laser Source - Ref. Setting

# 16 Using the MPN Module

**“Attenuation”:** Select from steps at 1.0dB, 0.5dB, 0.1dB, 0.05dB. The adjustable range of output power is 6 dB.

**“Ref.”:** Select “Set SLS output power as Ref” or “Manual input” to set the Ref. Click “Save” to save the Ref. setting.

## 16.5 Optical Power Meter of the MPN Module

Click “OPM” icon to enter Optical Power Meter interface, as shown in Fig 16.9.

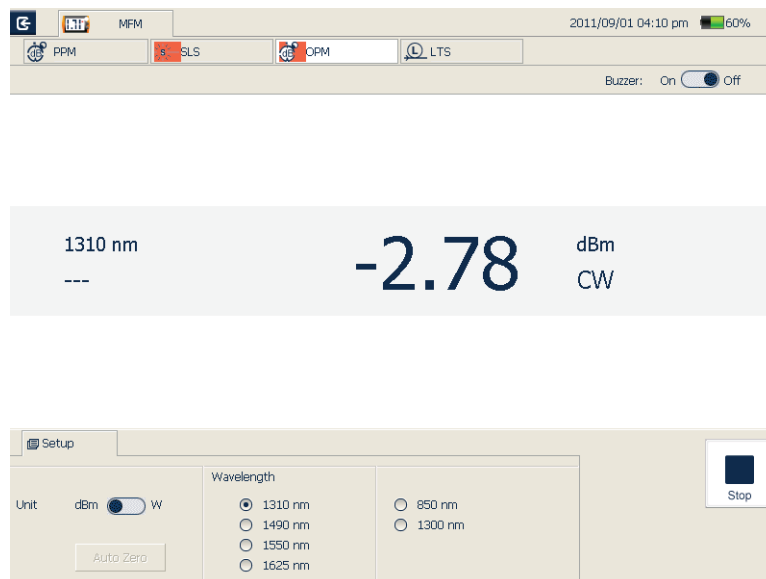


Fig 16.9 Optical Power Meter

After the setup, click  **Start** button, or press the  (Start/Stop) button on the PRO TP-P6 front panel to start the measurement. Click the  button or re-press the  (Start/Stop) button on the PRO TP-P6 front panel to stop the measurement.

### Note:

- The function icon turns **red** while switching on this function module.
- The wavelength of the OPM will be changed to the current wavelength automatically if the Modulation set of the SLS is set to “Auto ID”.

**“Unit”:** Shift between dBm and W.

**“Auto Zero”:** This function provides an easy method of auto zeroing the Power Meter, which can be used to rectify the instrument’s power value while in a non-luminous state during daily testing.

# 16 Using the MPN Module





## Note:

Always replace the protective cap on optical power testing output, and ensure that the tie-in is completely air-proof.

**“Wavelength”:** 850, 1300, 1310, 1490, 1550 and 1625nm wavelengths are user selectable.

## 16.6 Loss Test of MPN Module

Click the “LTS” icon to enter the “Loss Test” interface, as shown in Fig 16.10.

click the  Start button or Press the  (Start/Stop) button on the PRO TP-P6 front panel to start the measurement. Click  button, or re-press the  (Start/Stop) button on the PRO TP-P6 front panel to stop the measurement.

## Note:


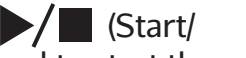
The function icon turns red while switching on this function module.

**“Wavelength”:** 1310, 1490, 1550, 1625nm wavelengths are user selectable.

**“Ref.”:** Select “Set Test Value as Ref” or “Manual Input” to set the Reference Value.

## 16.7 Optical Connector Inspection

Click the “OCI” icon to enter the Optical Connector Inspector interface, as shown in Fig 16.11.

Click the  Start button or press the  (Start/Stop) button on the PRO TP-P6 front panel to start the measurement, as shown in Fig 16.11

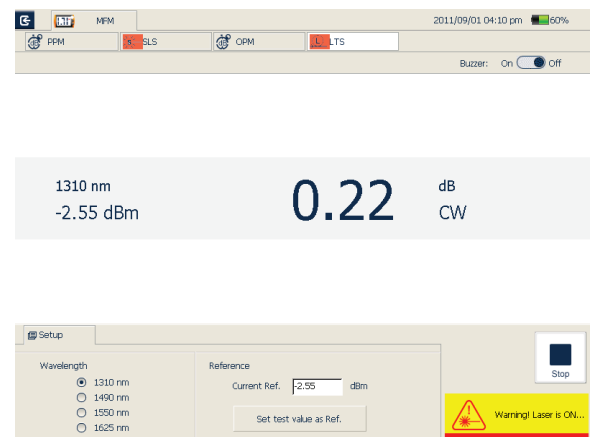


Fig16.10 Loss Test

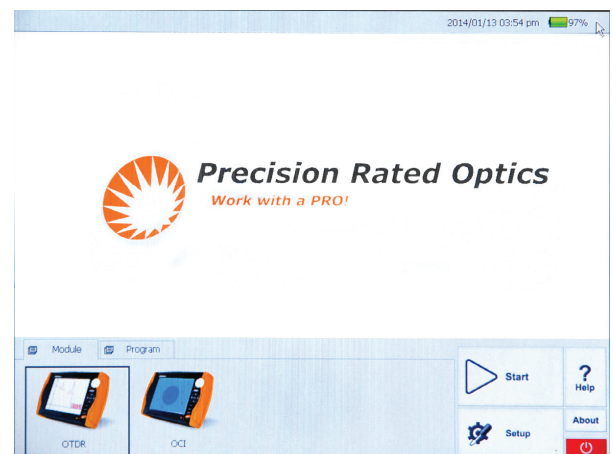




Fig. 16.11

# 16 Using the MPN Module

Click the  button, or re-press the  (Start/Stop) button on PRO TP-P6 front panel to stop the measurement.

## Note:

While the inspection function is active, the user can adjust the display brightness by sliding the black-and-white adjustment bar. To return the brightness to the factory default, simply click the “Reset” icon on the right-side of the display.

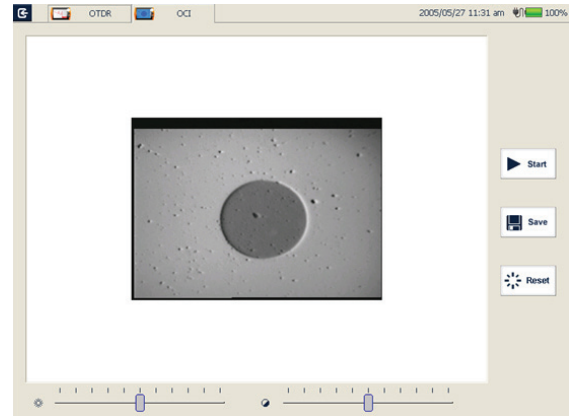



Fig. 16.12

The user can directly copy, move, rename and/or delete any image file or folder on the PRO TP-P6.

Files can also be exchanged between the PRO TP-P6 and external storage devices, such as a USB flash drive, external hard drive and/or PC. The storage device simply needs to have USB connection capability.

The PRO TP-P6 is equipped with two types of USB ports:

- USB host (Type “A”, flat).
- USB (Type “B”  , square).

# 17 File Management

## 17.1 Transferring Files or Folders Between the PRO TP-P6 and USB Storage Devices

1. Connect a USB storage device to the PRO TP-P6 USB port.
2. Click the “File Explorer” icon on the {Program} tab to enter File Explorer, where all connected, active drives (including USB drives and folders) are displayed for file management.
3. After a file transfer, the user can directly unplug the USB storage device from the PRO TP-P6.

### Note:

If the USB storage device is not shown in the File Explorer, please close the File Explorer and try again.

## 17.2 Transferring Files or Folders Between the PRO TP-P6 and a PC

### Note:


Microsoft ActiveSync software must first be installed on the PC for file transfer between the PRO TP-P6 and a PC.

Some necessary software must be installed on the PC before connecting the PRO TP-P6. For more information about installation, please refer to the included instructions, which are provided with the software setup CD.

1. If Microsoft **ActiveSync** software is not installed on the PC, please install it, then follow the software installation instruction.
2. Connect the USB cable type “A” (the rectangular “flat” connector) to the PC and the type “B” end (square shape) to the PRO TP-P6.
3. After the Microsoft ActiveSync software has been installed and indicates “Connected,” click “Explore” to access the files and folders on the PRO TP-P6, or access the files and folders from My Computer on your PC.
4. After file transfer is complete, simply disconnect the USB cable.

### Note:

There is no need to turn off the PC and/or the PRO TP-P6 when connecting and disconnecting the USB cable.

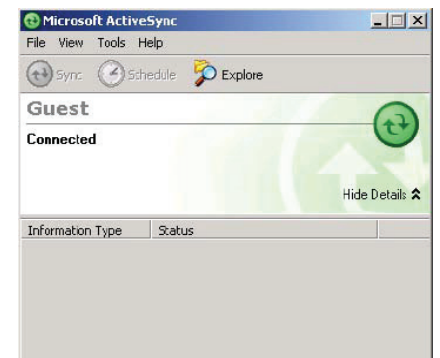

is  
to

Fig 16.1 ActiveSync Connected

## 17.3 Deleting Saved Files

1. Click the “File Explorer” icon on the {Program} tab to enter the File Explorer.
2. Click the “\SDMMC\_Disk” icon to enter the internal storage space.
3. Select the files or folders to be deleted.
4. Click “Delete” to finalize the deletion.

# 18 Maintenance and Calibration

## 18.1 Cleaning of Optical Interfaces

Interfaces must be kept clean. Special alcohol may be used to clean optical outputs. Always replace protective dust caps when the unit is not being used. Always keep the protective dust caps clean. Also, the outside of the ports should be periodically cleaned.

## 18.2 Necessity of Cleaning

The diameter of an optic core is 9um, and the diameter of dust and other particulates ranges from 1/100 to 1/10 um. Comparatively speaking, the size of a single speck of dust (and other particulates) can cover a significant portion of an optical fiber, and therefore degrade the performance of the PRO TP-P6.

Additionally, the power density may actually burn the dust into the optical fiber, creating further damage. As an example, 0dBm optic power may produce about 16000000W/m\*m power density in single mode fiber. In this were the case, measurement would be inaccurate and the damage would be irreversible.

## 18.3 Safety Instructions Before Cleaning

- a) Make sure the PRO TP-P6 is turned off when cleaning
- b) Any operations contradictory to the instructions may result in serious laser injuries.
- c) Make sure the Laser Source is turned off when cleaning the connectors.
- d) When the PRO TP-P6 is in operation, always avoid looking directly into the optical output. Although laser radiation is invisible, it can, and will, burn the retina, causing serious injury to the eyes.
- e) Be cautious of electric shock, and make sure that the A/C power is disconnected from the PRO TP-P6 before cleaning. Always use dry or moist, soft cloth to clean the outside of the PRO TP-P6. Never attempt to clean the inside of the TP-P6. If you suspect that the inside has been contaminated, please contact your local PRO service representative for further instructions.
- f) Please do not add any unauthorized accessories to the TP-P6, or attempt to adjust the unit in any way, other than through the built-in software interface.
- g) For maintenance, always send the unit to an authorized PRO repair center.

## 18.4 Typical Cleaning Tools

- a) Optical fiber cleaner (for cleaning of optical connectors)
- b) Optical fiber cleaning rod (for cleaning of optical outputs)
- c) Optical fiber cleaning tissue (for cleaning optical interfaces)
- d) Isopropyl alcohol
- e) Cotton ball
- f) Lint-free Tissue
- g) Cleaning brush
- h) Compressed air



# 18 Maintenance and Calibration



## 18.5 Cleaning Procedure

- a) Disconnect the protective cap from the flange.
- b) Clean the laser head carefully.
- c) Replace the protective cap.

## 18.6 Battery Charging Instructions

Typically, the PRO TP-P6 Lithium battery supports over 7 hours of continuous operation. Charging status is indicated in the system main interface, as well as the PRO TP-P6 front panel indicator.

1. In the system main interface, the charging status is displayed in the upper-right corner of the display.

Icon	Description
	DC input is on
	Battery remaining power

2. The front panel charging indicator also displays charging status (Please refer to 1.4 Front Panel Indicators Introduction).

## 18.7 Battery Instructions

### Note:

- When you first unpack your new TP-P6, the battery is not fully charged. Please charge the battery before using for the first time. Charging typically takes approximately four (x4) hours.
- The charging time is subject to the type of functional modules in use, environment, temperature, etc.
- If the TP-P6 sits unused for a long period of time (longer than two months) its capacity may not match the indicated charging status (for example, the charging indicator indicates "Full" but the PRO TP-P6 may power off, due to a low battery). In that case, battery calibration is necessary (Please refer to section 18.9 of this manual for "Battery Calibration" instructions).

### Warning!!

- Please do not store the battery in an environment where the temperature is over 60 °C (140 °F).
- Only use the specified charger to charge the battery.

## 18.8 Charging the Battery

Connect the A/C power adapter to the PRO TP-P6. Plug the other end into any wall outlet. The charging process will automatically start and finish when the battery is fully charged.

# 18 Maintenance and Calibration

## 18.9 Battery Calibration

After the battery either sits unused for a long period of time, or has been used frequently, the battery power level monitor may not be accurate. In some cases, for example, the battery can indicate that it is at least partially charged, yet the unit shuts down automatically due to a dead battery. If this occurs, the user will need to recalibrate the battery.

### Procedure:

1. Discharge the battery completely, leaving the unit on until the unit shuts down automatically.
2. Charge the battery until fully charged.

## 18.10 Change Battery

1. Power-off the PRO TP-P6 and unplug the power adapter.
2. Open the battery dock cover.
3. Change the battery.
4. Re-attach the battery dock cover.

### Note:

- Please Note: Always turn off the TP-P6 before performing a battery replacement.
- Only authorized service personnel can change the internal clock battery.

## 18.11 Calibration Requirements

Calibration of the PRO TP-P6 is recommended every two years. Please contact your nearest PRO representative, or contact our Customer Service Center for instructions on sending in the TP-P6 for proper calibration.

## 18.12 Shipment

The PRO TP-P6 should always be shipped in its original packing materials, if possible. Otherwise, the TP-P6 should be professionally packed for safe shipment. Precision Rated Optics is not liable for damage that may occur during shipping, due to incorrect or inadequate packing procedures.

Please note the following points when shipping the PRO TP-P6:

- Use original packing materials, if possible.
- Avoid excessive temperature and humidity changes.
- Avoid direct exposure to sunlight.
- Avoid shock and vibration.

# 19 Troubleshooting

## 19.1 Common Problems and Solutions

Problem	Possible Reason	Solution
TP-P6 does not power on	Battery power is depleted	<ul style="list-style-type: none"><li>• Charge the battery</li><li>• Replace the battery</li><li>• Connect the PRO TP-P6 to external power supply.</li></ul>
	External power supply is not connected	Connect PRO TP-P6 to external power supply.
	External power supply is unplugged	Make sure external power supply is well connected on both ends.
	Battery dock cover is not closed properly	Close the battery dock cover properly
Black Screen	Screen backlight is off, but power indicator is on.	Press any key to exit "Power Saving" mode.
	Battery depleted, the PRO TP-P6 is off and the power indicator is off.	<ul style="list-style-type: none"><li>• Charge the battery</li><li>• Replace the battery</li><li>• Connect the PRO TP-P6 to external power supply.</li></ul>
External keypad no response	External keypad is not recognized.	<ul style="list-style-type: none"><li>• Unplug the keypad and re-plug</li><li>• Power off PRO TP-P6, plug keypad and power on PRO TP-P6 again.</li></ul>
External mouse no response	External mouse is not recognized.	<ul style="list-style-type: none"><li>• Unplug the mouse and re-plug</li><li>• Power off PRO TP-P6, plug in the mouse and power on the PRO TP-P6 again.</li></ul>
Screen display blurs	Brightness is not set properly	Adjust brightness
Application no response	Problem error	Restart PRO TP-P6 and run the application again.
Operation time is short	Battery run out	Change the battery
	Battery is not fully charged	<ul style="list-style-type: none"><li>• Charge the battery</li><li>• Re-calibrate the battery</li></ul>
Touchscreen is not responding properly with stylus	Touch screen needs calibration	Connect external USB mouse to calibrate the stylus.
PRO TP-P6 indicates low battery after battery is fully charged	Battery is not fully charged.	Re-calibrate the battery

## 19.2 Trace Measurement Problems and Solutions

Problem	Possible Reason	Solution
Expected events are not shown in the trace	Events are too close to each other.	<ul style="list-style-type: none"><li>• Try again with short pulsewidth</li><li>• Try testing from the other end of the fiber</li></ul>
	SNR is poor	Try again with wide pulsewidth or increase averaging time.
	Wrong configuration	Check OTDR parameters, like Reflection Threshold, Non-Reflection Threshold and End Threshold. Re-analyze or test again.
Special events appear at the end of the trace	Wrong configuration, e.g. wrong end threshold setting.	Adjust configuration and test again.
	The fiber under test is too long to test accurately.	Select proper range and test again.

# 20 Warranty

## 20.1 Terms of Warranty

All Precision Rated Optics® products are warranted against defective material and workmanship for a period of one (1) year from the date of shipment to the original customer. Any product found to be defective within the warranty period will be repaired or replaced by Precision Rated Optics free of charge. In no case will Precision Rated Optics, Inc. liabilities exceed the original purchase price of the product.

## 20.2 Exclusion

The warranty on your equipment shall not apply to defects resulting from the following:

- Unauthorized repair or modification
- Misuse, negligence, or accident

Precision Rated Optics, Inc. reserves the right to make changes to any of its products, at any time, without having to replace or change previously purchased units.

## 20.3 Warranty Registration

A warranty registration card is included with the original shipment of equipment. Please take a few moments to fill out the card and mail or fax it to the local Customer Service Center of Precision Rated Optics, Inc. to ensure proper initiation of your warranty term and scope of your warranty.

## 20.4 Returning Instruments

To return instrument for reasons of yearly calibration or other, please contact the local Customer Service Center of Precision Rated Optics, Inc. to obtain additional information and a RMA# (Return Materials Authorization number). You should also describe the reasons for the return of the equipment, to allow us the opportunity to better service you.

### Note:

To return the PRO TP-P6 in the case of repair, calibration or other recommended maintenance, please note the following:

- Be sure to pack PRO TP-P6 with soft cushion like Polyethylene, so as to protect the shell of PRO TP-P6.
- Please use the original hard packing box. If use other packing material, please ensure at least 3 cm soft material around PRO TP-P6.
- Be sure to correctly fill out and return the warranty registration card, which should include the following information: company name, postal address, contact, phone number, email address and problem description.
- Be sure to seal the packing box with exclusive tape.
- Be sure to ship to our local representative or directly to us in a reliable way.

## 20.5 Contacting Customer Service

Please check our web site ([www.precisionratedoptics.com](http://www.precisionratedoptics.com)) for updates to this manual and additional application information. If you need technical or sales support, please contact your local Precision Rated Optics Customer Service Center, shown below:

**Precision Rated Optics, Inc.**  
***Product Distribution Center***  
***Manufacturing & Testing***

9999 Hamilton Blvd  
Breinigsville, PA 18031

**THANK YOU FOR CHOOSING  
PRECISION RATED OPTICS!!**

**[www.PrecisionRatedOptics.com](http://www.PrecisionRatedOptics.com)**

**DOC. P/N: MAN-PRO TP-P6 EN V1109**



**Precision Rated Optics, Inc.**

***National Sales Office***

2030 Blue Heron Circle  
Birmingham, AL 35242

**Precision Rated Optics, Inc.**

***Corporate Office***

***Billing & Processing***

PO Box 877 Trexlertown, PA 18087

**Precision Rated Optics, Inc.**

***Product Distribution Center***

***Manufacturing & Testing***

9999 Hamilton Blvd  
Breinigsville, PA 18031